


CITROEN GRAND C4 PICASSO: 1JXX997

Vinnumber:	VF73AAHRMFJ586827	Versionname:	2.0 BLUEHDI 150 MAN6 EXCLUSIVE
First Registrationdate:	16/03/2015	Fiscalpower:	
Expertise Mileage:	111772	Power Kw:	110
Bodytype:	MPV	Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4204
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage	HD	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

205/55/17/95 V LightMetal				
Summer tyres:	Fr.L.	Uniroyal: 6 mm	Fr.R.	Uniroyal: 6 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2519,41
Door F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R R, Scratch(es), LI - Repair and paint (complete)	318,35

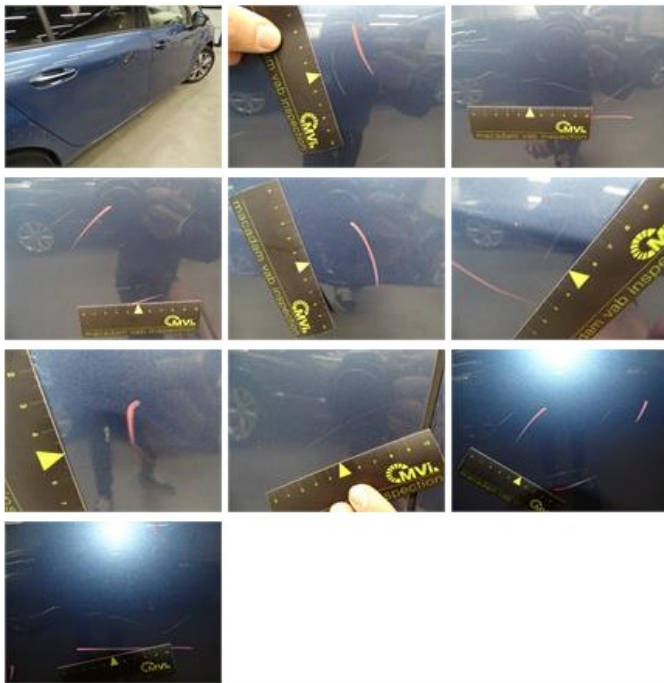

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20




Door F L, Chemical polution, 67 - Polish

0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete)

290,08

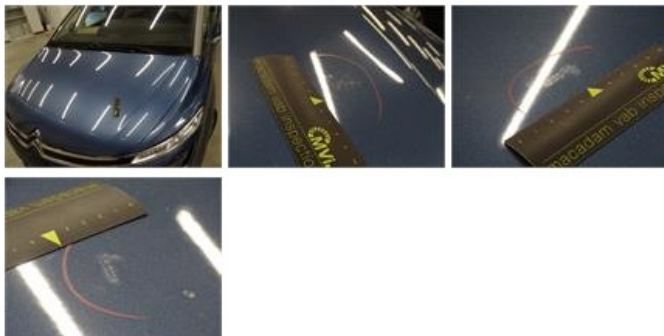

Door panel R R, Scratch(es), Smart repair

110,64



Sill trim R L, Scratch(es), Acceptable

0,00

No pictures to display

Interior, Dirty, Cleaning

0,00

No pictures to display

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)

95,00





Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper R, Scratch(es), Acceptable

0,00

No pictures to display

Sill trim R R, Scratch(es), Acceptable

0,00

No pictures to display

Door R L, Chemical polution, 67 - Polish


0,00

No pictures to display

Windscreen, Stone chip(s), E - Replace

0,00



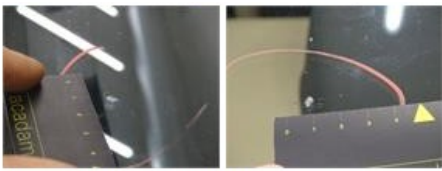

Door panel R L, Scratch(es), Smart repair

110,64



Roof, Chemical polution, LI - Repair and paint (complete)

481,50



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)

95,00

