

**VOLKSWAGEN PASSAT VARIANT: 1JVH746**

Vinnumber:	<b>VVWZZZ3CZFE468633</b>	Versionname:	<b>1.6 TDI VARIANT COMFORTLINE</b>
First Registrationdate:	<b>5/03/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>177193</b>	Power Kw:	<b>88</b>
Bodytype:	<b>Break</b>	Body color:	<b>Brown</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2704</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	<b>No Tow bar</b>
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Autom climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**




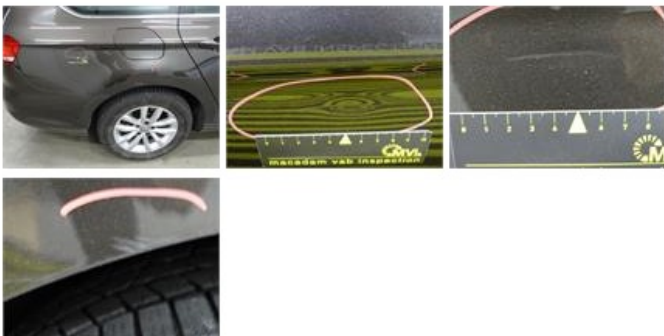
	<b>215/60/16/99 H LightMetal</b>			
Winter tyres:	Fr.L.	<b>Semperit: 4 mm</b>	Fr.R.	<b>Semperit: 4 mm</b>
	Re.L.	<b>Continental: 6 mm</b>	Re.R.	<b>Continental: 6 mm</b>

**Assistance equipment**

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-------------	------------	------	------------

Total cost ex VAT	<b>1627,68</b>
Backrest cover F L, Worn, E - Replace	<b>360,00</b>



Bumper F, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Bumper R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R L, Dent(s), LI - Repair and paint (complete)	318,35
	
Bonnet, Dent(s), PDR - Paintless dent repair	102,60
	
Roof, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)	220,18
	
Door F R, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	308,20
	
Bodywork, Not original part, Acceptable	0,00
<i>No pictures to display</i>	
Door F L, Dent(s), LI - Repair and paint (complete)	318,35
