



PEUGEOT 508 SW: 1NNA216

Vinnumber:	VF38EBHXFL022366	Versionname:	1.6 BLUEHDI S/S AUTO ACTIVE
First Registrationdate:	22/03/2016	Fiscalpower:	
Expertise Mileage:	115139	Power Kw:	85
Bodytype:	Break	Body color:	Black
Gearbox:	Automatic	Paint type:	Metallic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3631
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Panoramic roof	
Windows electric F		Central consol F	
Windows electric R		Luggage cover	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Type of headlighting	Headlighting Halogen	Type of Tow bar	Tow bar removable
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-leather		
Type of climate control	Autom climate control		
Head-up Display			

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	NOT OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/60/16/99 H LightMetal			
Winter tyres:	Fr.L.	Continental: 3 mm	Fr.R.	Continental: 3 mm
	Re.L.	Semperit: 3 mm	Re.R.	Semperit: 3 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	1440,26
-------------------	----------------

Door F L, Scratch(es), LI - Repair and paint (complete)	318,35
---	---------------





Tailgate, Scratch(es), LI - Repair and paint (complete) 301,68



Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror housing R, Scratch(es), 67 - Polish 0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08




Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display

Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35

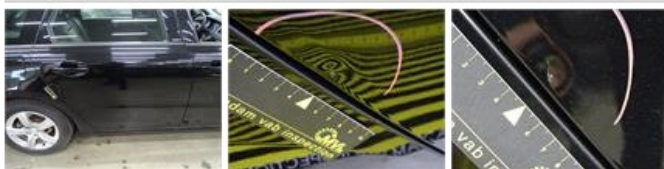

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display

Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Rear window, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80

