


OPEL Astra: 1GS132

Vinnnummer:	W0LPC6EA7E1106553	Versionname:	ASTRA BER ecoFLEX Essentia S&S 95PK
First Registrationdate:	15/04/2014	Fiscalpower:	
Expertise Mileage:	83792	Power Kw:	70
Bodytype:	Hatchback	Body color:	Red
Gearbox:	MAN 5 VIT	Paint type:	Opaque
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4629
Number of doors:	5		
Number of seats:	5		
Number head rests:	4		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Luggage cover	
GPS storage		Type of Tow bar	No Tow bar
GPS storage	HD		
Windows electric F			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	No climate control		

Limited Technical Inspection

Tires wear profile	OK	Battery functioning	Yes
Idle position	OK	Power steering	Yes
Engine startingtime	OK	Sound engine	OK
Exhaust gass	OK	Clutch test	OK
Handbrake	OK	Wiper fluid level	OK
		Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/60/16/99 H Steel			
Winter tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1295,55
Rocker panel inner R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F L, Scratch(es), LI - Repair and paint (complete)	318,35




Rocker panel inner R R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner F L, Dent(s), LI - Repair and paint (complete) 115,56

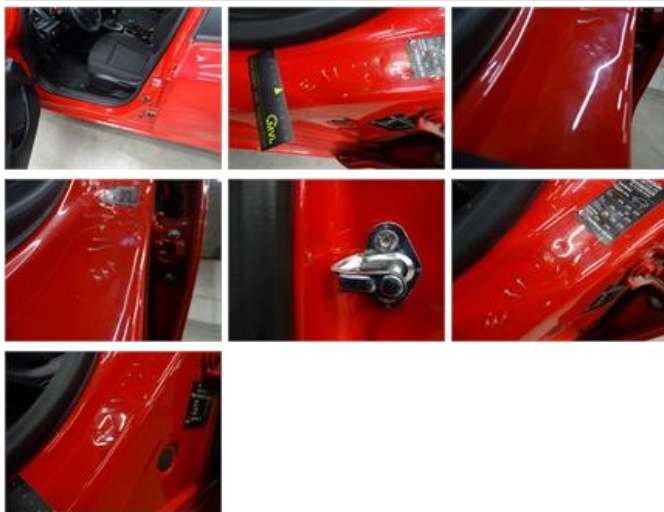

Wing R L, Dent(s), Acceptable 0,00

No pictures to display

Rocker panel inner F R, Dent(s), LI - Repair and paint (complete) 115,56



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical polition, LI - Repair and paint (complete) 290,08



Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

