



## VOLKSWAGEN GOLF VII: 1KVV759

Vinnumber:	<b>WVWZZZAUZGW029150</b>	Versionname:	<b>1.6 TDI 66KW TRENDLINE</b>
First Registrationdate:	<b>16/07/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>179703</b>	Power Kw:	<b>66</b>
Bodytype:		Body color:	<b>Blue</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3327</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

## Options

Windows electric F		Central consol F	
Cruise Control		Luggage cover	
Steering wheel multifunctional		Front parking sensors	
Radio multimedia		Rear parking sensors	
Type of headlighting	<b>Headlighting Halogen</b>	Type of Tow bar	<b>Tow bar fixed</b>
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Autom climate control</b>		
Adaptive cruise control			

## Limited Technical Inspection

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

## Degree of wear

	<b>195/65/15/91 H Steel</b>			
Winter tyres:	Fr.L.	<b>Michelin: 4 mm</b>	Fr.R.	<b>Michelin: 4 mm</b>
	Re.L.	<b>Michelin: 4 mm</b>	Re.R.	<b>Michelin: 4 mm</b>

## Assistance equipment

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT	1266,46
Bumper F, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Wing R L, Dent(s), LI - Repair and paint (complete)	308,20



Covering interior A pillar L, Burned, Smart repair

110,64



Seat cover F L, Burned, Smart repair

64,32



Trunk lid covering R, Scratch(es), Acceptable

0,00

No pictures to display

Roof, Scratch(es), LI - Repair and paint (complete)

481,50



Wing R R, Dent(s), Acceptable

0,00

No pictures to display

Door F R, Dent(s), Acceptable

0,00

No pictures to display

Wheel cover R R, Broken, E - Replace

30,00




Windscreen, Repaired, Acceptable

0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80

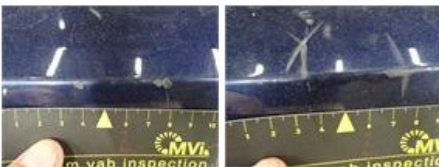

Wheel cover F R, Scratch(es), E - Replace

30,00



Wheel cover F L, Broken, E - Replace

30,00

