


RENAULT SC?NIC: 1KGX547

Vinnumber:	VF1JZ14K652946584	Versionname:	1.5 ENERGY DCI 110 LIFE
First Registrationdate:	30/04/2015	Fiscalpower:	
Expertise Mileage:	97740	Power Kw:	81
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1128
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Type of Tow bar	No Tow bar
Windows electric F			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 H Steel			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 3 mm	Re.R.	Michelin: 3 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	933,69
-------------------	--------

Rearview mirror housing R, Scratch(es), 67 - Polish	55,19
---	-------

No pictures to display


Wing R L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Wheel cover F R, Broken, E - Replace	30,00
--------------------------------------	-------



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80

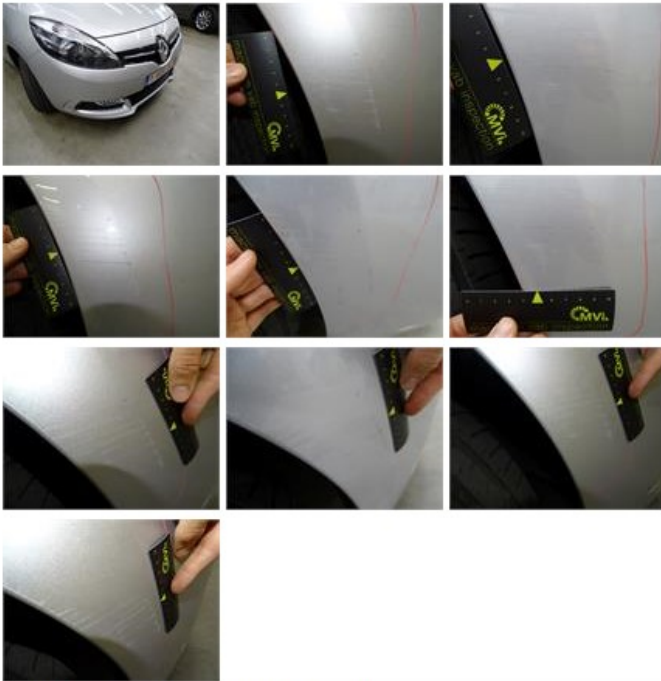

Trunk lid covering R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Instruction book, Missing, E - Replace 0,00

No pictures to display

Door R R, Dent(s), Acceptable 0,00

No pictures to display

Maintenance book, Missing, E - Replace 0,00

No pictures to display

Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



