



AUDI Q5: 1GWE728

Vinnumber:	WAUZZZ8R0EA124689	Versionname:	Q5 150PK
First Registrationdate:	16/05/2014	Fiscalpower:	
Expertise Mileage:	108949	Power Kw:	110
Bodytype:	SUV	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1125
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

235/65/17/104 W LightMetal				
Summer tyres:	Fr.L.	Pirelli: 7 mm	Fr.R.	Pirelli: 7 mm
	Re.L.	Goodyear: 6 mm	Re.R.	Goodyear: 6 mm

Assistance equipment

Emergency spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0


Total cost ex VAT	2742,37
Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Scratch(es), LI - Repair and paint (complete) 577,80

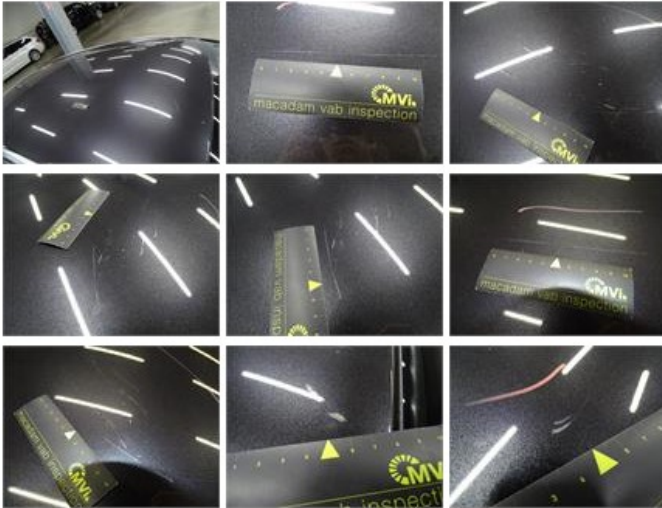

Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Trunk lid covering R, Scratch(es), Smart repair 110,64



Bumper cover R M, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 254,16



Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00



Bonnet, Chemical polution, LI - Repair and paint (complete)

348,09



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02



Tailgate, Scratch(es), Acceptable

0,00

No pictures to display

Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)

115,56



Bumper R, Scratch(es), LI - Repair and paint (complete)

254,16





Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper moulding F L, Broken, E - Replace 17,28



Bumper F M, Scratch(es), Smart repair 110,64



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02

