



VOLVO V40: GD4155

Vinnumber:	YV1MV8481F2235012	Versionname:	1.6 D2 BASE
First Registrationdate:	21/03/2015	Fiscalpower:	
Expertise Mileage:	149849	Power Kw:	84
Bodytype:		Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3509
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	195/65/15/91 H Steel			
Winter tyres:	Fr.L.	Dunlop: 5 mm	Fr.R.	Dunlop: 5 mm
	Re.L.	Dunlop: 6 mm	Re.R.	Dunlop: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	2729,28
-------------------	----------------


Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)	235,80
---	---------------



Interior, Dirty, Acceptable 0,00

No pictures to display

Windscreen, Broken, E - Replace 487,20

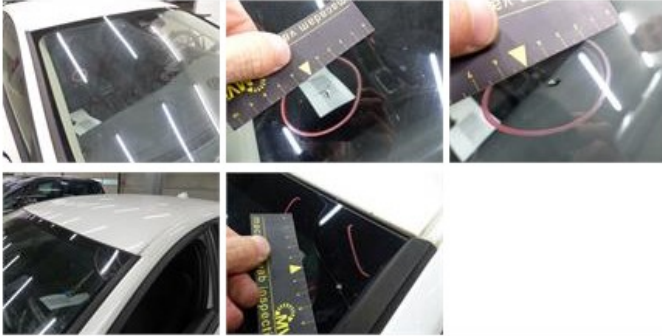

Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Wheel cover F R, Missing, E - Replace 30,00



Sill outer R, Dent(s) and scratch(es), Le - Replace and paint 712,00



Door F R, Scratch(es), LI - Repair and paint (complete) 318,35



Rear Panel Internal Lining, Scratch(es), E - Replace 74,00



Mirror side blinker R, Broken, E - Replace

30,00



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Rearview mirror housing R, Broken, E - Replace

19,60



Trunk lid covering R, Scratch(es), Acceptable

0,00

No pictures to display

Bodywork, Not original part, Remove lettering

0,00



Wing F R, Dent(s), LI - Repair and paint (complete)

292,18

