



**CITROEN Berlingo: DT4089**

Vinnumber:	<b>VF77B9HF0DN525805</b>	Versionname:	<b>BERLINGO B/F Kort Fresh GPS 90PK</b>
First Registrationdate:	<b>13/08/2013</b>	Fiscalpower:	
Expertise Mileage:	<b>106869</b>	Power Kw:	<b>66</b>
Bodytype:	<b>Transporter</b>	Body color:	<b>White</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Opaque</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>4811</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>3</b>		
Number head rests:	<b>3</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Light Commercial Vehicle</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Type of Tow bar	<b>No Tow bar</b>
Windows electric F		
Radio multimedia		
Type of headlighting	<b>Headlighting Halogen</b>	
Type of GPS	<b>GPS big screen color</b>	
Type of Lining	<b>Lining fabrics</b>	
Type of climate control	<b>Manual climate control</b>	

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>195/65/15/91 H Steel</b>			
Winter tyres:	Fr.L.	<b>Michelin: 4 mm</b>	Fr.R.	<b>Michelin: 4 mm</b>
	Re.L.	<b>Michelin: 5 mm</b>	Re.R.	<b>Michelin: 5 mm</b>

**Assistance equipment**

Emergency spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

<b>Total cost ex VAT</b>	<b>1862,68</b>
<b>Wing F R, Scratch(es), LI - Repair and paint (complete)</b>	<b>165,13</b>



<b>Boot carpet, Tear, E - Replace</b>	<b>75,00</b>
---------------------------------------	--------------



Wheel cover F R, Scratch(es), E - Replace 22,50



Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete) 232,88



Door trim R R, Scratch(es), E - Replace 91,50



Sliding door R, Dent(s), LI - Repair and paint (complete) 382,02



Wheel cover R R, Scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror housing R, Broken, E - Replace 74,00



Rearview mirror housing L, Broken, E - Replace 74,00





Wheel cover R L, Scratch(es), E - Replace 22,50



Wheel cover F L, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Dent(s), LI - Repair and paint (complete) 361,13

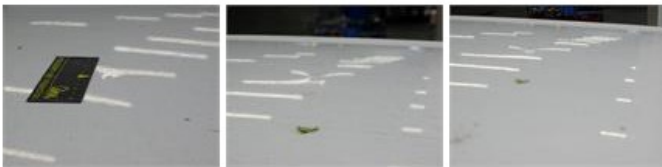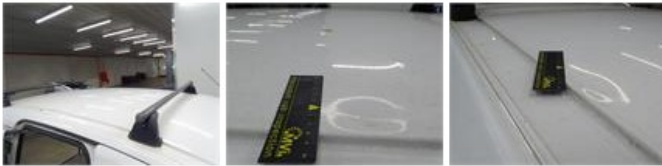

Door F R, Dent(s), Acceptable 0,00

No pictures to display

Tailgate, Dent(s), LI - Repair and paint (complete)

362,02

