



AUDI A3: 1HYP467

Vinnumber:	WAUZZZ8V2FA061898	Versionname:	
First Registrationdate:	30/10/2014	Fiscalpower:	
Expertise Mileage:	113192	Power Kw:	81
Bodytype:	Hatchback	Body color:	Brown
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2125
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1348,61
-------------------	---------

Bumper F, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display


Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	--------



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

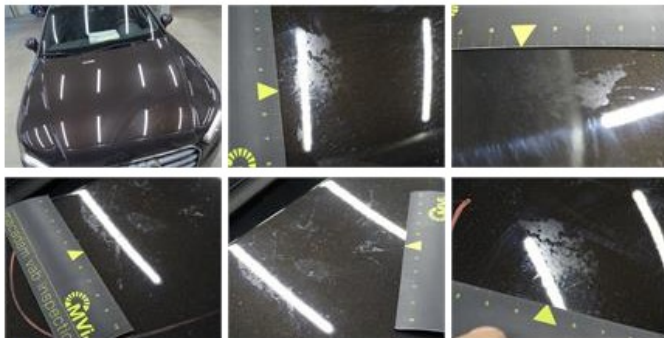

Rearview mirror housing L, Bad repair, Acceptable 0,00



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Rear window, Scratch(es), Acceptable 0,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80





Roof pillar L, Chemical polution, LI - Repair and paint (complete)

220,18



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20

