



**IVECO Daily 40C15: 1EBG865**

Vinnumber:	<b>ZCFC40A5005894967</b>	Versionname:	<b>DAILY B/F2C 40C15 146PK 3500KG</b>
First Registrationdate:	<b>10/10/2012</b>	Fiscalpower:	
Expertise Mileage:	<b>210482</b>	Power Kw:	<b>107</b>
Bodytype:		Body color:	<b>White</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Opaque</b>
Transmission:	<b>Back</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>LCV16</b>
Number of doors:	<b>4</b>		
Number of seats:	<b>7</b>		
Number head rests:	<b>7</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Light Commercial Vehicle</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Central consol F	
Windows electric F	Type of Tow bar	<b>Tow bar fixed</b>
Radio multimedia		
Type of headlighting	<b>Headlighting Halogen</b>	
Type of GPS	<b>No GPS</b>	
Type of Lining	<b>Lining fabrics</b>	
Type of climate control	<b>No climate control</b>	

**Limited Technical Inspection**

Tires wear profile	<b>OK</b>	Battery functioning	<b>Yes</b>
Idle position	<b>OK</b>	Power steering	<b>Yes</b>
Engine startingtime	<b>OK</b>	Sound engine	<b>OK</b>
Exhaust gass	<b>OK</b>	Clutch test	<b>OK</b>
Handbrake	<b>OK</b>	Wiper fluid level	<b>OK</b>
		Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>195/75/16/105 R Steel</b>			
Summer tyres:	Fr.L.	<b>Michelin: 5 mm</b>	Fr.R.	<b>Michelin: 5 mm</b>
	Re.L.	<b>Michelin: 6 mm</b>	Re.R.	<b>Michelin: 6 mm</b>

**Assistance equipment**

Spare wheel	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>
Number of charging cables (rapid charge)	<b>0</b>

Total cost ex VAT 3403,00

Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 165,13





Sill outer R, Deformed / Strained, LI - Repair and paint (complete)

232,88



Windscreen, Crack, E - Replace

395,40



Roof, Dent(s), Acceptable

0,00

No pictures to display

Tailgate, Dent(s) and scratch(es), Le - Replace and paint

799,99



Sidewall RR (LCV), Scratch(es), Acceptable

0,00

No pictures to display






Sidewall RL (LCV), Dent(s) and scratch(es), It - Spot repair


115,56



Instruction book, Missing, E - Replace

0,00

Instruction book, missing, E - Replace	0,00
No pictures to display	
Door panel R L, Crack, E - Replace	91,50
	
Door panel R R, Crack, E - Replace	91,50
	
Bodywork, Not original part, Acceptable	0,00
No pictures to display	
Door R L, Rust, Acceptable	0,00
No pictures to display	
Door R R, Scratch(es), Acceptable	0,00
No pictures to display	
Bonnet, Dent(s), Acceptable	0,00
No pictures to display	
Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)	238,76
	
Sunblind R, Missing, E - Replace	112,50
	
Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)	238,76
	
Wing F L, Dent(s), Acceptable	0,00
No pictures to display	
Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete)	232,88

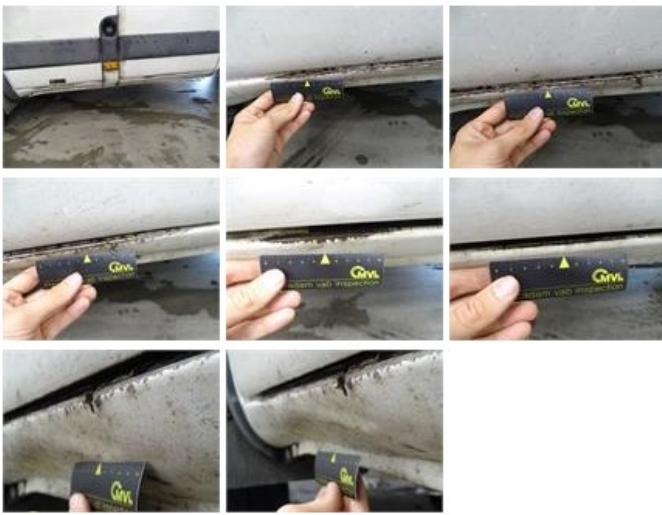

Dashboard, Hole, E - Replace

577,50



Bumper F, Dent(s) and scratch(es), Smart repair

110,64

