



MINI Countryman: 1DWC487			
Vinnumber:	WMWZD11090WL27183	Versionname:	MINI COUNTRYMAN One D DPF 90PK
First Registrationdate:	14/09/2012	Fiscalpower:	
Expertise Mileage:	112382	Power Kw:	66
Bodytype:	SUV	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2304
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options			
Radio CD		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	No GPS		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	205/60/16/92 H LightMetal			
Summer tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment			
Number of charging cables (normal)	0	Jack	Yes
Number of charging cables (rapid charge)	0		
Total cost ex VAT			870,56
Alloy rim F L, Scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Door R L, Scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Bumper R, Scratch(es), LI - Repair and paint (complete)			211,80



Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display

Door trim R R, Scratch(es), E - Replace 114,00



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80




Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete) 115,56



Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Dent(s), PDR - Paintless dent repair 122,40

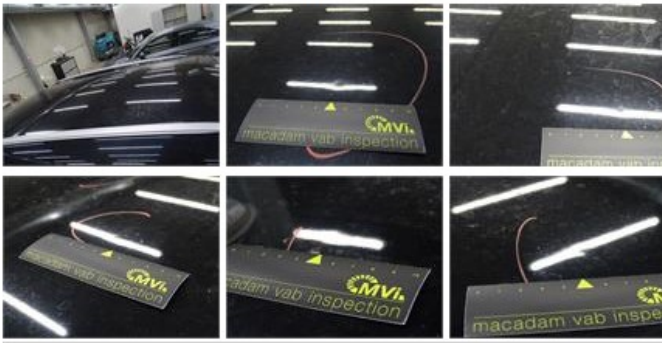

Bonnet, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	