



VOLVO V60: PW1020

Vinnumber:	VV1FW31A1F1256352	Versionname:	2.0 D3 KINETIC
First Registrationdate:	17/02/2015	Fiscalpower:	
Expertise Mileage:	188050	Power Kw:	100
Bodytype:	Break	Body color:	Dark Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3330
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Sun Roof electric	
GPS storage	HD	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

215/55/16/97 H LightMetal				
Winter tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Pirelli: 6 mm	Re.R.	Pirelli: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		


Total cost ex VAT 1974,18

Tailgate, Scratch(es), LI - Repair and paint (complete) 301,68



Door F L, Scratch(es), LI - Repair and paint (complete)

318,35

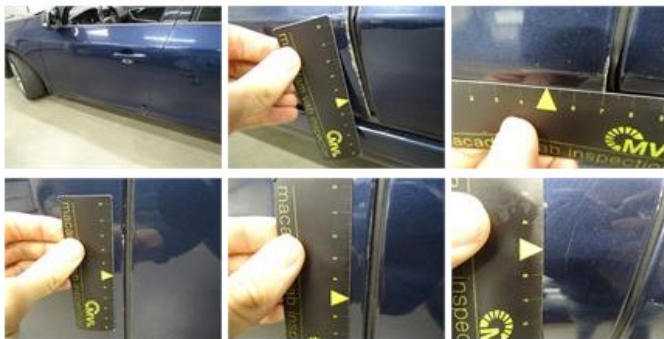

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Windscreen, Stone chip(s), Acceptable

0,00



Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Wing F L, Scratch(es), Acceptable

0,00

No pictures to display

Wing R L, Scratch(es), Acceptable

0,00

No pictures to display

Door F R, Scratch(es), LI - Repair and paint (complete)

318,35





Wing R R, Scratch(es), LI - Repair and paint (complete)

308,20



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Door R R, Scratch(es), Acceptable

0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Rear window, Scratch(es), Acceptable

0,00



Door panel R R, Tear, E - Replace

114,00

