



**SEAT Alhambra: 1FRR613**

Vinnumber:	<b>VSSZZZ7NZEV504151</b>	Versionname:	<b>ALHAMBRA E-Ecom.Busin.Limit.136PK</b>
First Registrationdate:	<b>3/10/2013</b>	Fiscalpower:	
Expertise Mileage:	<b>137649</b>	Power Kw:	<b>100</b>
Bodytype:	<b>MPV</b>	Body color:	<b>Dark Blue</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3719</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>7</b>		
Number head rests:	<b>7</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Seats F heated	<b>No Tow bar</b>
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Autom climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>205/60/16/96 H Steel</b>			
Winter tyres:	Fr.L.	Fr.R.	Fulda: 7 mm
	Re.L.	Re.R.	Bridgestone: 6 mm

**Assistance equipment**

Total cost ex VAT	2393,84
Wheel cover F L, Missing, E - Replace	36,00



No pictures to display

Wheel cover F R, Missing, E - Replace

36,00




Bonnet, Dent(s), Acceptable

0,00

No pictures to display

Interior, Dirty, Cleaning

150,00

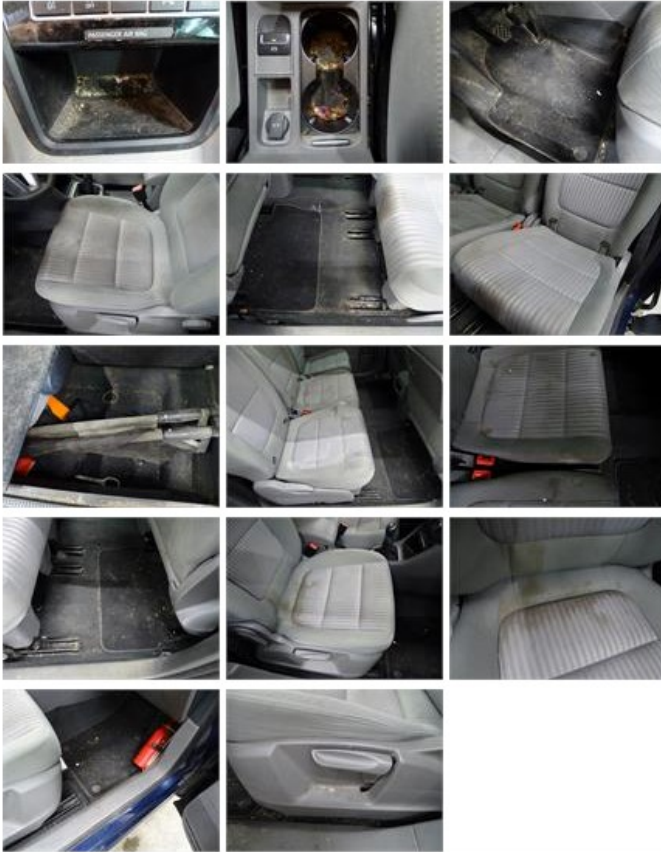

Reflector, Broken, E - Replace

20,00



Wing R R, Scratch(es), LI - Repair and paint (complete)

369,84



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02



Interior, Dirty, Chemical cleaning

150,00



Roof, Chemical polution, LI - Repair and paint (complete) 577,80



Wheel cover R R, Scratch(es), E - Replace 36,00



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Windscreen, Scratch(es), E - Replace 0,00



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02



Bumper R, Scratch(es), LI - Repair and paint (complete) 254,16

