



TOYOTA RAV4: 1PZA175

Vinnumber:	JTMYPREV40D019537	Versionname:	2.0 D-4D DPF Premium 4x2
First Registrationdate:	17/10/2016	Fiscalpower:	
Expertise Mileage:	38483	Power Kw:	105
Bodytype:	SUV	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3413
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats electric F L	
GPS storage	HD	Sun Roof electric	
GPS storage		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	No Tow bar
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	235/55/18/104 V LightMetal			
Winter tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment


Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1809,93
Bumper cover R M, Dent(s) and scratch(es), Smart repair	110,64



Door F R, Scratch(es), LI - Repair and paint (complete)

318,35

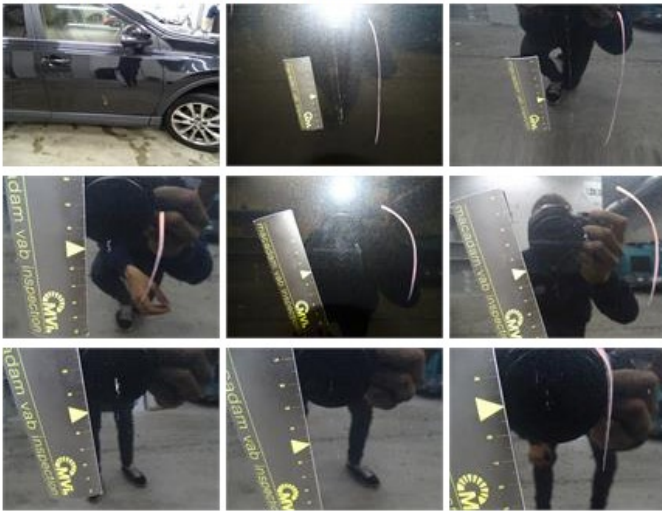

Door R R, Scratch(es), LI - Repair and paint (complete)

318,35



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper F M, Scratch(es), Smart repair

110,64





Door panel F L, Dirty, Acceptable 0,00



Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display


Rocker panel inner F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Door R L, Scratch(es), LI - Repair and paint (complete) 318,35

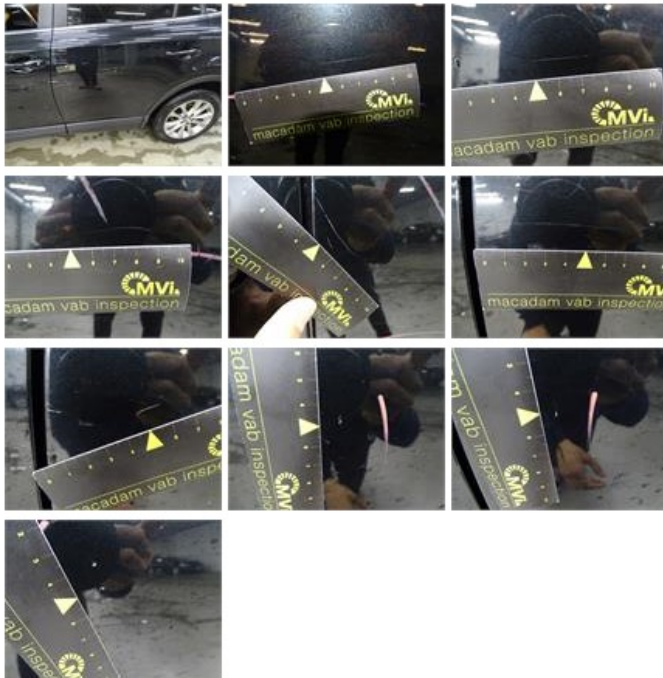

Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Armrest L, Scratch(es), Acceptable 0,00





Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Outer door handle F R, Scratch(es), Acceptable

0,00

No pictures to display

Protection plate M, Missing, E - Replace

20,00

