



## VOLKSWAGEN POLO: 1JSB987

Vinnumber:	<b>WVWZZZ6RZFY250286</b>	Versionname:	<b>1.4 TDI 66KW COMFORTLINE BMT</b>
First Registrationdate:	<b>11/02/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>85055</b>	Power Kw:	<b>66</b>
Bodytype:	<b>Hatchback</b>	Body color:	<b>Black</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2111</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

## Options

Radio CD		Central consol F	
GPS storage	<b>SD</b>	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	<b>No Tow bar</b>
Cruise Control			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Autom climate control</b>		

## Limited Technical Inspection

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

## Degree of wear

	<b>185/60/15/84 H LightMetal</b>			
Summer tyres:	Fr.L.	<b>Hankook: 3 mm</b>	Fr.R.	<b>Hankook: 3 mm</b>
	Re.L.	<b>Hankook: 6 mm</b>	Re.R.	<b>Hankook: 6 mm</b>

## Assistance equipment

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT	<b>1413,60</b>
Rear window, Scratch(es), E - Replace	<b>0,00</b>



Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

246,56



Door R R, Dent(s), Acceptable

0,00

No pictures to display

Maintenance book, Missing, E - Replace

0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

169,44







Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Tailgate, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)


95,00



Roof, Dent(s), PDR - Paintless dent repair

201,60



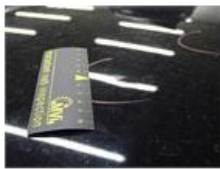


Windscreen, Stone chip(s), Acceptable

0,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

246,56

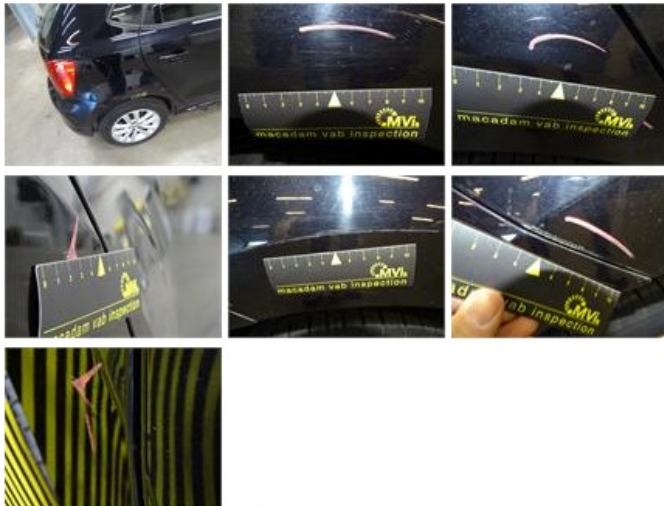

Door R L, Bad repair, Acceptable

0,00



Roof pillar L, Scratch(es), Acceptable

0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete)

169,44

