



**AUDI A3: 1HCY196**

Vinnumber:	<b>WAUZZZ8VXF1024971</b>	Versionname:	<b>A3 SED Attraction 105PK</b>
First Registrationdate:	<b>20/06/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>180801</b>	Power Kw:	<b>81</b>
Bodytype:		Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2326</b>
Number of doors:	<b>4</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Central consol F
TV/DVD screen F	Rear parking sensors
Windows electric F	Type of Tow bar
Windows electric R	<b>No Tow bar</b>
Cruise Control	
Steering wheel multifunctional	
Seats F heated	
Radio multimedia	
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Autom climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>205/55/16/91 W LightMetal</b>				
Summer tyres:	Fr.L.	<b>Continental: 4 mm</b>	Fr.R.	<b>Continental: 4 mm</b>
	Re.L.	<b>Continental: 3 mm</b>	Re.R.	<b>Continental: 3 mm</b>

**Assistance equipment**

Emergency spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-----------------------	------------	------	------------

Total cost ex VAT	<b>2193,06</b>
-------------------	----------------

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)	<b>211,80</b>
---	---------------



Bumper grille F R, Deformed / Strained, E - Replace 32,40




Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Roof, Chemical polution, LI - Repair and paint (complete) 481,50



Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

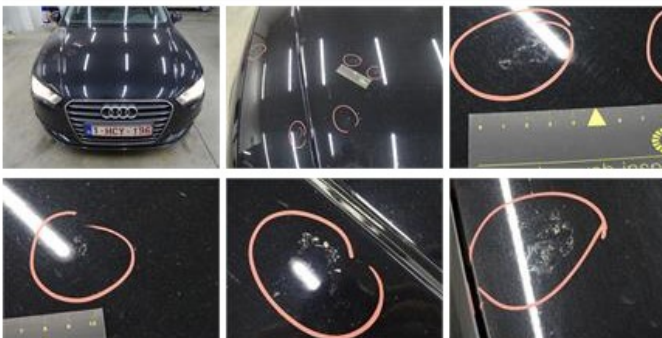

Outer door handle F R, Scratch(es), Acceptable 0,00

No pictures to display

Door R L, Dent(s), PDR - Paintless dent repair 102,60



Tailgate, Chemical polution, LI - Repair and paint (complete) 301,68



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00





Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Windscreen, Stone chip(s), Acceptable 0,00



Door R R, Dent(s), Acceptable 0,00

*No pictures to display*

Alloy rim F L, Scratch(es), Acceptable 0,00

*No pictures to display*

Door F L, Dent(s), PDR - Paintless dent repair 63,00

