



FORD Galaxy: 1JFN234

| | | | |
|------------------------------------|--------------------------|--------------|---------------------------------------|
| Vinnumber: | WF0MXXGBWMEA09171 | Versionname: | GALAXY ECO Tit.Style DPF 136PK |
| First Registrationdate: | 3/12/2014 | Fiscalpower: | |
| Expertise Mileage: | 116271 | Power Kw: | 100 |
| Bodytype: | MPV | Body color: | Grey |
| Gearbox: | MAN 6 VIT | Paint type: | Metalic |
| Transmission: | Front | Rims summer: | Aluminium |
| Fueltype: | Diesel | Oil level: | OK |
| Battery functioning: | Yes | Parking lot: | 4805 |
| Number of doors: | 5 | | |
| Number of seats: | 7 | | |
| Number head rests: | 7 | | |
| Rims summer: | Aluminium | | |
| Category: | Passenger Car | | |
| Oil level: | OK | | |
| Registration Certificate Car (BE): | Yes | | |

Options

| | | | |
|--------------------------------|------------------------------|-----------------------|----------------------|
| Radio CD | | Seats electric F L | |
| GPS storage | | Seats electric F R | |
| GPS storage | HD | Central consol F | |
| Windows electric F | | Luggage cover | |
| Windows electric R | | Front parking sensors | |
| Cruise Control | | Rear parking sensors | |
| Steering wheel multifunctional | | Type of Tow bar | Tow bar fixed |
| Seats F heated | | | |
| Radio multimedia | | | |
| Type of headlighting | Headlighting Halogen | | |
| Type of GPS | GPS big screen color | | |
| Type of Lining | Lining leather | | |
| Type of climate control | Autom climate control | | |

Limited Technical Inspection

| | | | |
|---------------------|-----------|---------------------|------------|
| Airco functioning | OK | Battery functioning | Yes |
| Tires wear profile | OK | Power steering | Yes |
| Idle position | OK | Sound engine | OK |
| Engine startingtime | OK | Clutch test | OK |
| Exhaust gass | OK | Wiper fluid level | OK |
| Handbrake | OK | Transmission | OK |
| | | Lighting | OK |
| | | Wiperblades | OK |

Degree of wear

| | | | | |
|----------------------------------|-------|-----------------------|-------|-----------------------|
| 225/50/17/98 W LightMetal | | | | |
| Summer tyres: | Fr.L. | Michelin: 5 mm | Fr.R. | Michelin: 5 mm |
| | Re.L. | Kleber: 5 mm | Re.R. | Kleber: 5 mm |

Assistance equipment

| | | | |
|--|------------|------------|------------|
| Repair kit | Yes | Compressor | Yes |
| Number of charging cables (normal) | 0 | | |
| Number of charging cables (rapid charge) | 0 | | |

| | |
|--|----------------|
| Total cost ex VAT | 2422,47 |
| Bonnet, Scratch(es), LI - Repair and paint (complete) | 348,09 |



Spoiler R, Scratch(es), It - Spot repair

115,56



Bumper F, Scratch(es), LI - Repair and paint (complete)

254,16



Door R R, Bad repair, Acceptable

0,00



Ceiling, Damaged, E - Replace

564,00






Door F R, Dent(s), PDR - Paintless dent repair 63,00



Windscreen, Stone chip(s), E - Replace 560,64

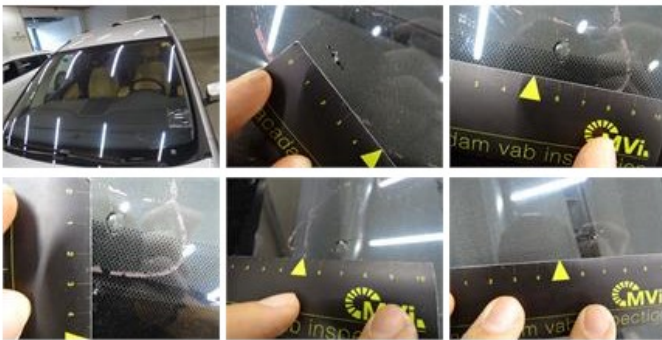

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Door R L, Dent(s), LI - Repair and paint (complete) 382,02



Wing R R, Dent(s), Acceptable 0,00

No pictures to display

Brand badge R, Missing, E - Replace 20,00



Reflector, Broken, E - Replace

20,00

