



RENAULT Grand Scenic: 1GIQ649

Vinnumber:	VF1JZ14M650302690	Versionname:	GRAND SCENIC Energy Life 5pl.110PK
First Registrationdate:	18/02/2014	Fiscalpower:	
Expertise Mileage:	175702	Power Kw:	81
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4323
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Luggage cover	
GPS storage	SD	Front parking sensors	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/60/16/96 H LightMetal				
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		


Total cost ex VAT	1553,38
Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)	318,35



Bonnet, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20

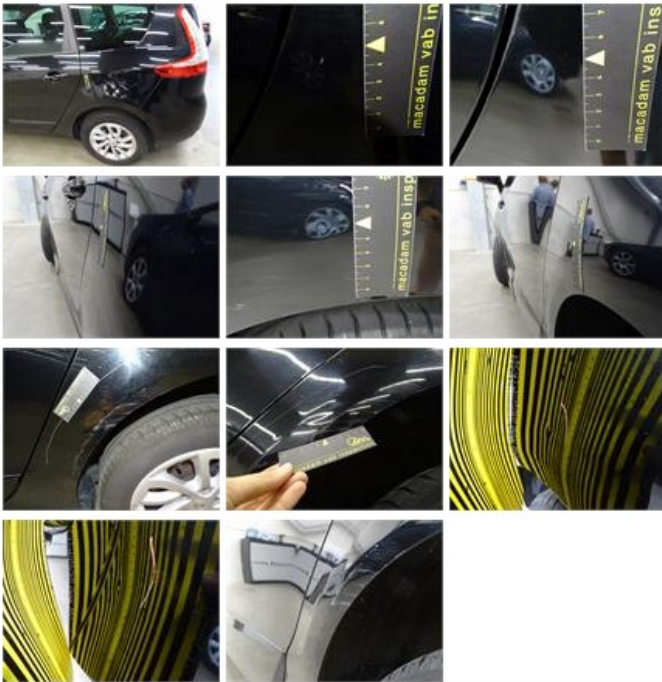

Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete) 304,68





Rear window, Scratch(es), Acceptable 0,00



Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Bad repair, Acceptable 0,00



Bumper spoiler F, Scratch(es), Acceptable 0,00

No pictures to display

Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Molding trunk, Damaged, Acceptable 0,00

No pictures to display

Door F R, Bad repair, Acceptable 0,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00

