



BMW 3 TOURING: 1NHT808

Vinnumber:	WBA8H51060K741116	Versionname:	2.0 318D (110KW) XDRIVE TOURING
First Registrationdate:	29/02/2016	Fiscalpower:	
Expertise Mileage:	177769	Power Kw:	110
Bodytype:	Break	Body color:	Dark Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3601
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats electric F L	
Windows electric F		Seats electric F R	
Windows electric R		Central consol F	
Cruise Control		Luggage cover	
Steering wheel multifunctional		Rear parking sensors	
Seats F heated		Type of Tow bar	Tow bar fixed
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-leather		
Type of climate control	Autom climate control		
Sport seats			

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 V LightMetal			
Summer tyres:	Fr.L.	Vredestein: 7 mm	Fr.R.	Vredestein: 7 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Repair kit	No	Compressor	Yes
------------	-----------	------------	------------

Total cost ex VAT	1550,76
-------------------	----------------

Alloy rim R R, Scratch(es), Acceptable	0,00
--	-------------

No pictures to display

Door F L, Scratch(es), Acceptable	0,00
-----------------------------------	-------------

No pictures to display

Wing R R, Scratch(es), LI - Repair and paint (complete)	308,20
---	---------------




Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80




Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80

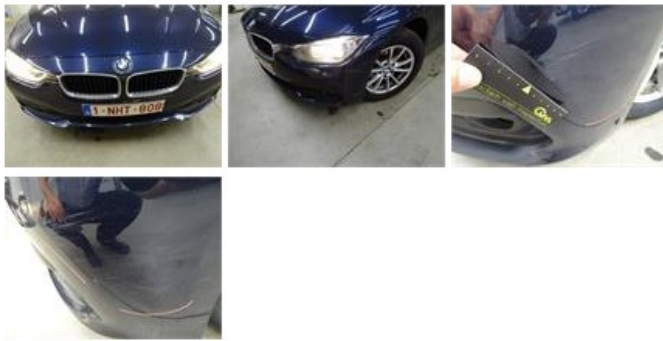


Bonnet, Chemical polution, LI - Repair and paint (complete)

290,08

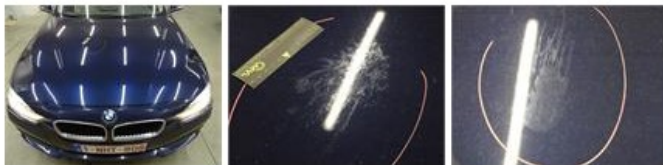

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

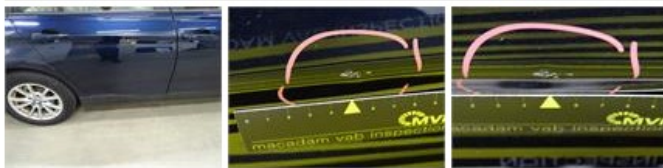

Door R L, Dent(s), Acceptable

0,00

No pictures to display

Wing R L, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim R L, Scratch(es), Acceptable

0,00

No pictures to display

Tyre repair kit, Missing, E - Replace

210,53

No pictures to display

Alloy rim F L, Scratch(es), Acceptable

0,00

No pictures to display