



SKODA OCTAVIA COMBI: 1KKV237

Vinnumber:	TMBJG9NE9F0234025	Versionname:	1.6 CRTDI 77KW DSG 7 GREENTEC ELEGANCE
First Registrationdate:	22/05/2015	Fiscalpower:	
Expertise Mileage:	175464	Power Kw:	77
Bodytype:	Break	Body color:	White
Gearbox:	Automatic	Paint type:	Opaque
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1533
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar removable
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	NOT OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

225/45/17/91 W LightMetal				
Summer tyres:	Fr.L.	Bridgestone: 1 mm	Fr.R.	Bridgestone: 1 mm
	Re.L.	Pirelli: 3 mm	Re.R.	Pirelli: 3 mm

Assistance equipment

Repair kit	No	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	983,53
Windscreen, Stone chip(s), Windscreen repair	0,00

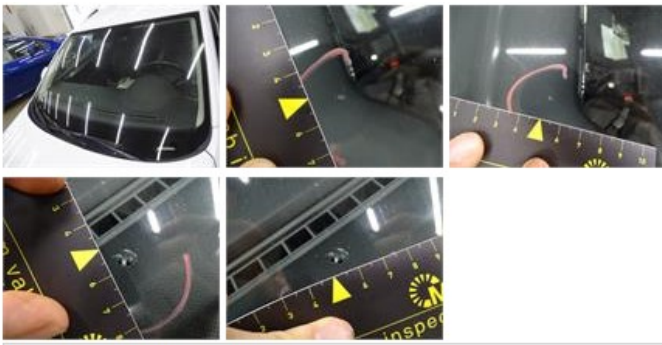

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s), PDR - Paintless dent repair 63,00



Tailgate, Bad repair, Acceptable 0,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00




Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



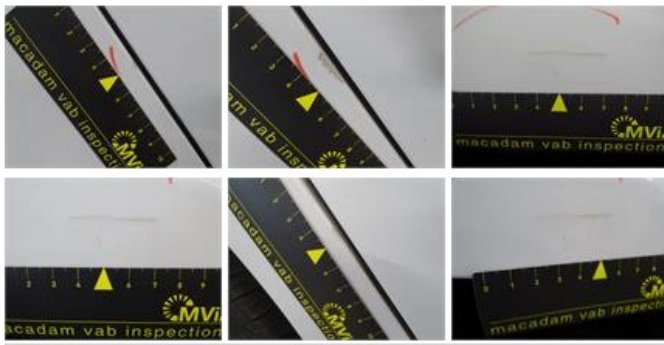

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



Tyre repair kit, Missing, E - Replace

210,53

No pictures to display