



RENAULT Trafic: 1GPU681

Vinnumber:	VF1FLA0A8EY746307	Versionname:	TRAFIC 27 B/F L1H1 Gr.Conf.FAP(E5)90PK
First Registrationdate:	27/03/2014	Fiscalpower:	
Expertise Mileage:	98909	Power Kw:	66
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LCV31
Number of doors:	6		
Number of seats:	3		
Number head rests:	3		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F	
Windows electric F	Type of Tow bar	Tow bar fixed
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS base	
Type of Lining	Lining fabrics	
Type of climate control	Manual climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/65/16/105 T Steel				
Summer tyres:	Fr.L.	Michelin: 7 mm	Fr.R.	Michelin: 7 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Emergency spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	2959,39
Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	231,15






Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Dent(s), LI - Repair and paint (complete) 361,13

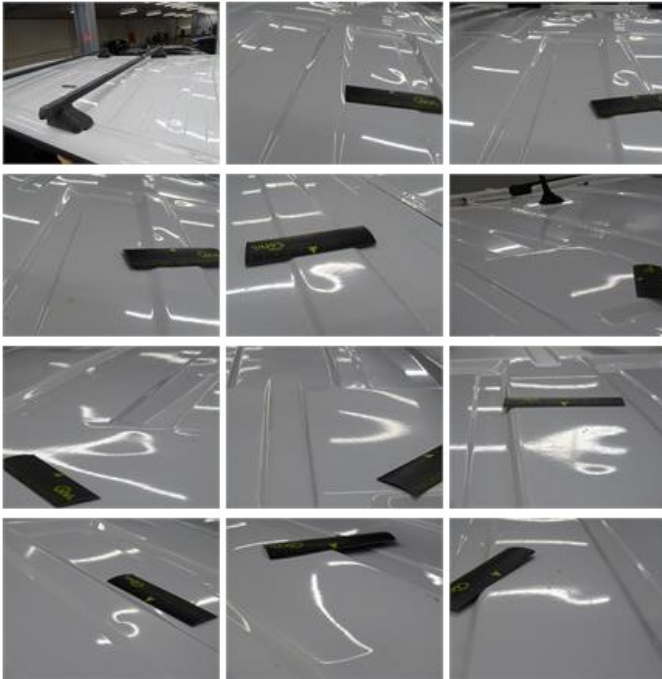

Trunk door R L, Dent(s) and scratch(es), It - Spot repair 115,56



Trunk door R R, Dent(s) and scratch(es), It - Spot repair 115,56



Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Sill outer L, Scratch(es), LI - Repair and paint (complete) 232,88





Wheel cover F L, Scratch(es), E - Replace

22,50



Bodywork, Not original part, Acceptable

0,00

No pictures to display

Wheel cover F R, Scratch(es), E - Replace

22,50




Wheel cover R R, Scratch(es), E - Replace

22,50



Bumper F, Scratch(es), Smart repair

110,64

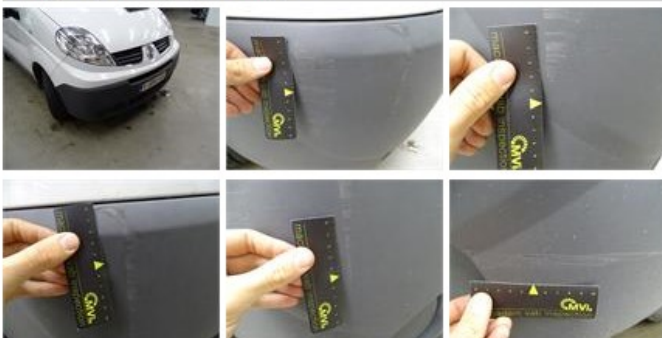



Bumper R, Hole, E - Replace 329,40



Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Windscreen, Scratch(es), E - Replace 395,40



Floor covering F L, Hole, E - Replace 237,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 231,15





Ignition key, Missing, E - Replace	150,00
------------------------------------	--------

No pictures to display

Sliding door R, Dent(s) and scratch(es), LI - Repair and paint (complete)	382,02
---	--------

