



RENAULT Grand Scenic: 1GKX492

Vinnumber:	VF1JZ14P650566947	Versionname:	GRAND SCENIC Business 7pl.110PK
First Registrationdate:	6/03/2014	Fiscalpower:	
Expertise Mileage:	143095	Power Kw:	81
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2127
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F	
Windows electric F	Luggage cover	
Windows electric R	Front parking sensors	
Cruise Control	Rear parking sensors	
Steering wheel multifunctional	Type of Tow bar	No Tow bar
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection


Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/96 H Steel			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Total cost ex VAT	1237,09
Wing F L, Scratch(es), LI - Repair and paint (complete)	220,18

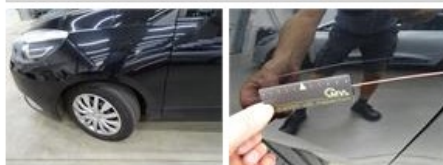

<i>No pictures to display</i>		
Wing F R, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Bumper R, Scratch(es), LI - Repair and paint (complete)		211,80
Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)		318,35
Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)		308,20
Door F R, Dent(s), Acceptable		0,00
<i>No pictures to display</i>		
Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)		115,56
Wing R L, Dent(s), Acceptable		0,00
<i>No pictures to display</i>		
Bonnet, Dent(s), Acceptable		0,00
<i>No pictures to display</i>		
Door R L, Dent(s), PDR - Paintless dent repair		63,00