



MERCEDES CLA: 1NPP122

Vinnumber:	WDD1173081N290379	Versionname:	
First Registrationdate:	4/04/2016	Fiscalpower:	
Expertise Mileage:	62550	Power Kw:	100
Bodytype:	Berline	Body color:	Light Grey
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3425
Number of doors:	4		
Number of seats:	5		
Number head rests:	1		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Sun Roof electric	
GPS storage		Central consol F	
GPS storage	SD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/40/18/92 Y LightMetal				
Summer tyres:	Fr.L.	Continental: 6 mm	Fr.R.	Continental: 6 mm
	Re.L.	Continental: 7 mm	Re.R.	Continental: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1808,88
Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)	95,00



Tailgate, Dent(s), Acceptable 0,00

No pictures to display
Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Tyre R R, Tear, E - Replace 132,00



Door F L, Dent(s), Acceptable 0,00

No pictures to display
Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim R L polished, Scratch(es), Acceptable 0,00


No pictures to display
Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Tyre F R, Tear, Acceptable 0,00



Bonnet, Chemical pollution, LI - Repair and paint (complete) 290,08

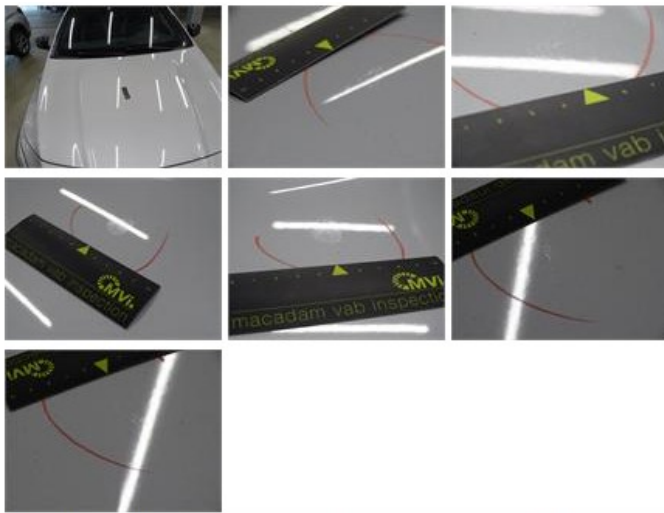


Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Rear window, Scratch(es), E - Replace

370,00

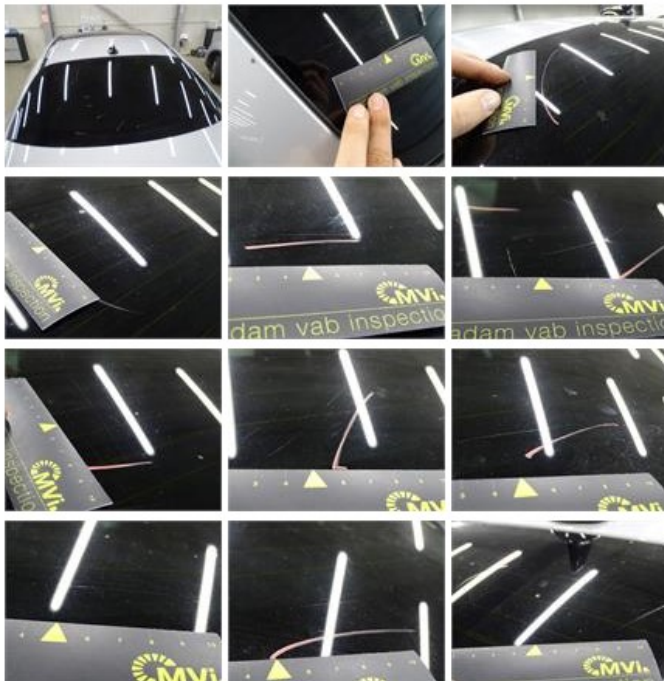

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



