



RENAULT Grand Scenic: KG9409			
Vinnumber:	VF1JZNAB650845841	Versionname:	GRAND SCENIC Bose Ed.7pl.130PK
First Registrationdate:	20/06/2014	Fiscalpower:	
Expertise Mileage:	158792	Power Kw:	96
Bodytype:	MPV	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1106
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options			
Radio CD		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	Tow bar removable
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather and alcantara		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	205/55/17/95 V LightMetal			
Summer tyres:	Fr.L.	Continental: 7 mm	Fr.R.	Continental: 7 mm
	Re.L.	Continental: 8 mm	Re.R.	Continental: 8 mm

Assistance equipment	
Total cost ex VAT	1029,60
Wing R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R L, Dent(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F L, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)	95,00



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Tailgate, Rust, LI - Repair and paint (complete) 301,68



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00




Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Wing F L, Scratch(es), 67 - Polish 0,00

No pictures to display

Rocker panel inner R L, Dent(s), LI - Repair and paint (complete) 115,56

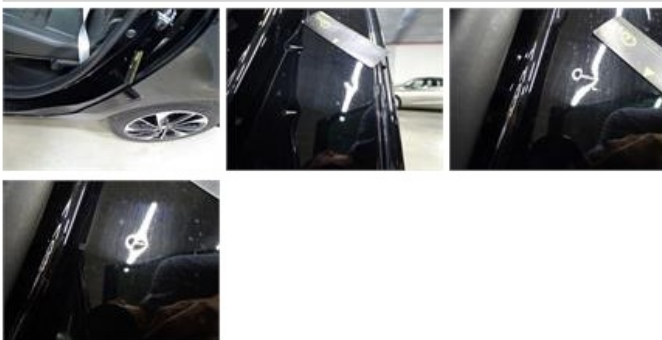

Rocker panel inner R R, Dent(s), LI - Repair and paint (complete) 115,56

