



VOLKSWAGEN PASSAT VARIANT: 1KCE524

Vinnumber:	VVWZZZ3CZFE468593	Versionname:	2.0 TDI VARIANT COMFORTLINE
First Registrationdate:	31/03/2015	Fiscalpower:	
Expertise Mileage:	120590	Power Kw:	110
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2820
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	Front parking sensors
Steering wheel multifunctional	Rear parking sensors
Radio multimedia	Type of Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control
	Tow bar fixed

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

	215/60/16/95 V LightMetal			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1544,56
Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80

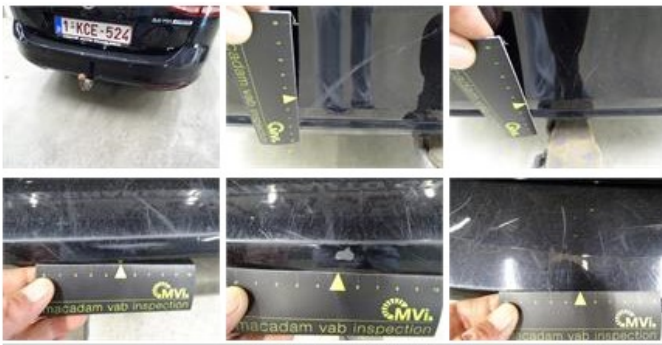

Rearview mirror housing R, Broken, Le - Replace and paint 372,40



Rocker panel inner R L, Dent(s), LI - Repair and paint (complete) 115,56



Wing R L, Dent(s), Acceptable 0,00

No pictures to display

Shutter / cover, Missing, E - Replace 14,80



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Trunk lid covering R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F, Broken, Le - Replace and paint 735,00



Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical polution, Acceptable 0,00

