



RENAULT CLIO: 1KBC959

Vinnumber:	VF15R040H52686246	Versionname:	1.5 DCI 75 DYNAMIQUE
First Registrationdate:	24/03/2015	Fiscalpower:	
Expertise Mileage:	67916	Power Kw:	55
Bodytype:	Hatchback	Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1204
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	No Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

195/55/16/87 T LightMetal				
Summer tyres:	Fr.L.	Bridgestone: 4 mm	Fr.R.	Bridgestone: 4 mm
	Re.L.	Bridgestone: 8 mm	Re.R.	Bridgestone: 8 mm




Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	835,28
Bumper R, Scratch(es), Smart repair	110,64

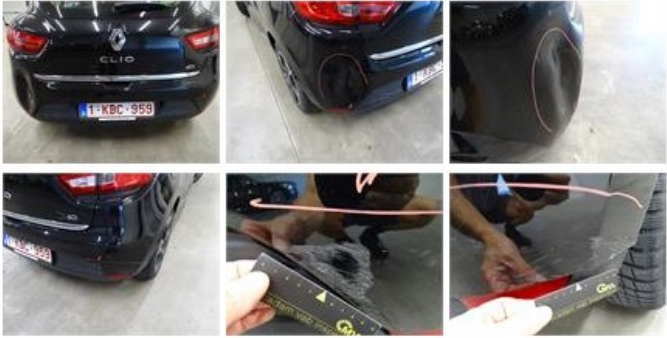

Wing R R, Scratch(es), Acceptable	0,00
-----------------------------------	------

<i>No pictures to display</i>		
Roof pillar R, Dent(s), Acceptable		0,00
<i>No pictures to display</i>		
Bumper R, Dent(s) and scratch(es), Le - Replace and paint		535,20
		
Alloy rim R L polished, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Wing F R, Chemical polution, 67 - Polish		0,00
<i>No pictures to display</i>		
Reflector, Broken, E - Replace		20,00
		
Bumper F, Scratch(es), LI - Repair and paint (complete)		169,44
		
Bonnet, Stone chip(s), Acceptable		0,00
<i>No pictures to display</i>		