



## MINI : 1KGV952

Vinnumber:	WMWXT110302B77379	Versionname:	1.5 ONE D
First Registrationdate:	30/04/2015	Fiscalpower:	
Expertise Mileage:	140376	Power Kw:	70
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2121
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

## Options

Windows electric F		Sun Roof electric	
Windows electric R		Panoramic roof	
Radio multimedia		Luggage cover	
Type of headlighting	Headlighting Halogen	Type of Tow bar	No Tow bar
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

## Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

## Degree of wear

	<b>175/65/15/84 H LightMetal</b>			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

## Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1443,03
Door F R, Scratch(es), 67 - Polish			0,00
<i>No pictures to display</i>			
Door F L, Scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Wing moulding F R, Scratch(es), E - Replace			14,40



Bumper moulding F, Scratch(es), E - Replace

14,40



Bonnet, Chemical polution, 67 - Polish

0,00

*No pictures to display*

Door R L, Scratch(es), LI - Repair and paint (complete)

318,35



Door trim R R, Scratch(es), E - Replace

114,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Door R R, Dent(s), Acceptable

0,00

*No pictures to display*


Wing R L, Scratch(es), Acceptable

0,00

*No pictures to display*

Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80

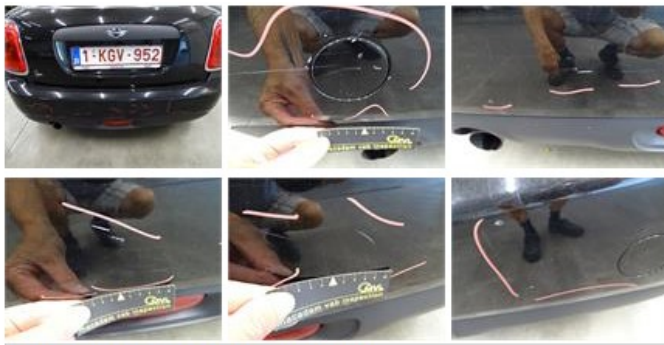

Bonnet, Dent(s), PDR - Paintless dent repair

63,00



Rearview mirror housing R, Scratch(es), Smart repair

110,64



Rearview mirror housing L, Scratch(es), Smart repair

110,64



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Wing trim R R, Scratch(es), E - Replace

84,00

