


AUDI A4 AVANT: 1KTK601

Vinnumber:	WAUZZZ8K8FA152261	Versionname:	2.0 TDI ULTRA 100KW
First Registrationdate:	30/06/2015	Fiscalpower:	
Expertise Mileage:	118504	Power Kw:	100
Bodytype:	Break	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2208
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats electric F L	
GPS storage	HD	Sun Roof electric	
GPS storage		Panoramic roof	
Windows electric F		Central consol F	
Windows electric R		Luggage cover	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Seats F heated		Type of Tow bar	No Tow bar
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

Summer tyres:	215/60/16/95 V LightMetal			
	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Vredestein: 7 mm	Re.R.	Vredestein: 7 mm

Assistance equipment

Emergency spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	759,34
Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	0,00

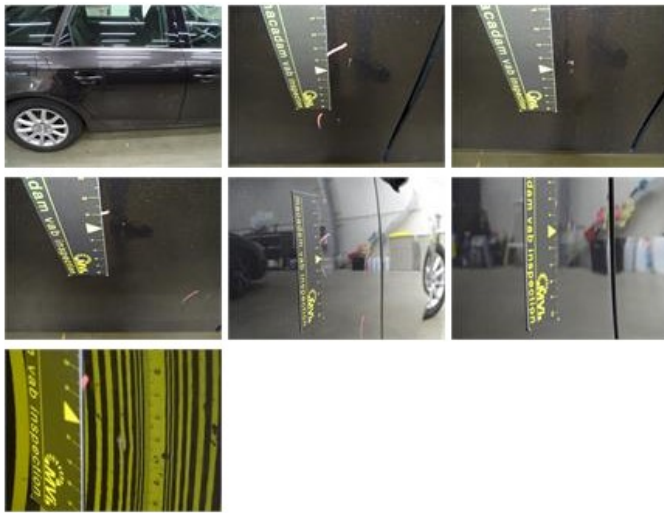

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

0,00



Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Tailgate, Scratch(es), Acceptable

0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80





Bonnet, Stone chip(s), Acceptable	0,00
-----------------------------------	------

No pictures to display

Alloy rim R R, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)	220,18
---	--------



Wing R L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Alloy rim F L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Rocker panel inner R R, Dent(s), LI - Repair and paint (complete)	115,56
---	--------



Wing R R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display