


AUDI A5: 1HRN805

Vinnumber:	WAUZZZ8T0FA016165	Versionname:	A5 SB Quat.S-tr. DPF 177PK Aut.
First Registrationdate:	15/09/2014	Fiscalpower:	
Expertise Mileage:	63159	Power Kw:	130
Bodytype:		Body color	Grey
Gearbox:	Automatic	Paint type	Metallic
Transmission:	Back	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	4611
Number of doors	5		
Number of seats	4		
Number head rests	4		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

GPS storage	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Seats F heated	
Radio multimedia	
Type of headlighting	Headlighting Xenon
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

245/45/17/95 Y LightMetal				
Summer tyres:	Fr.L.	Bridgestone: 3 mm	Fr.R.	Bridgestone: 3 mm
	Re.L.	Bridgestone: 5 mm	Re.R.	Bridgestone: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Total cost ex VAT			2603,85
Sunblind L, Broken, E - Replace			180,00



Interior, Dirty, Acceptable

0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

254,16



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

417,84



Bonnet, Dent(s), PDR - Paintless dent repair

63,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)


95,00



Wing F L, Scratch(es), LI - Repair and paint (complete)

264,21



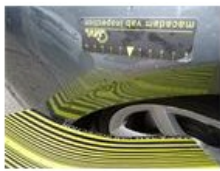

Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Wing R L, Dent(s), PDR - Paintless dent repair

63,00



Bumper R, Scratch(es), Acceptable

0,00

No pictures to display

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

430,02




Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02

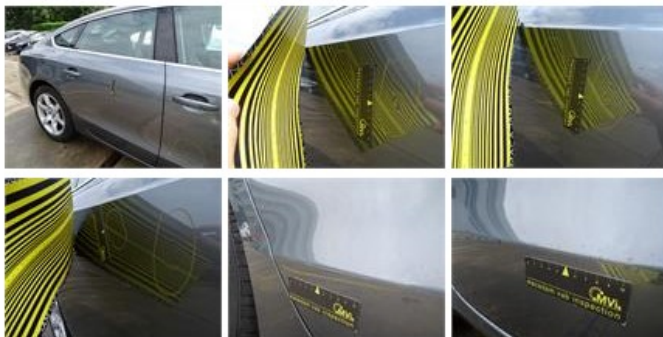

Tyre F R, Worn, E - Replace

153,60



Door R L, Dent(s), PDR - Paintless dent repair

111,00



Tailgate, Dent(s) and scratch(es), Acceptable

0,00

No pictures to display