



## CITROEN C3 PICASSO: 1RTC602

Vinnumber:	<b>VF7SHBHY6HT507431</b>	Versionname:	<b>1.6 BLUEHDI 100 MAN EXCLUSIVE</b>
First Registrationdate:	<b>23/02/2017</b>	Fiscalpower:	
Expertise Mileage:	<b>66905</b>	Power Kw:	<b>73</b>
Bodytype:		Body color:	<b>Red</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2415</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

## Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	Type of Tow bar
Radio multimedia	<b>No Tow bar</b>
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining semi-Alcantara</b>
Type of climate control	<b>Autom climate control</b>

## Limited Technical Inspection

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

## Degree of wear

	<b>195/55/16/91 T LightMetal</b>			
Summer tyres:	Fr.L.	<b>Michelin: 4 mm</b>	Fr.R.	<b>Michelin: 4 mm</b>
	Re.L.	<b>Michelin: 6 mm</b>	Re.R.	<b>Michelin: 6 mm</b>

## Assistance equipment

Repair kit	<b>Yes</b>	Compressor	<b>No</b>
------------	------------	------------	-----------

Total cost ex VAT	1528,44
-------------------	---------

Alloy rim R L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Wing F R, Deformed / Strained, LI - Repair and paint (complete)	176,14
---	--------



Door F L, Dent(s), Acceptable 0,00

*No pictures to display*

Compressor, Missing, E - Replace 0,00




Bumper F, Chemical polution, LI - Repair and paint (complete) 169,44



Bonnet, Chemical polution, LI - Repair and paint (complete) 232,06



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00

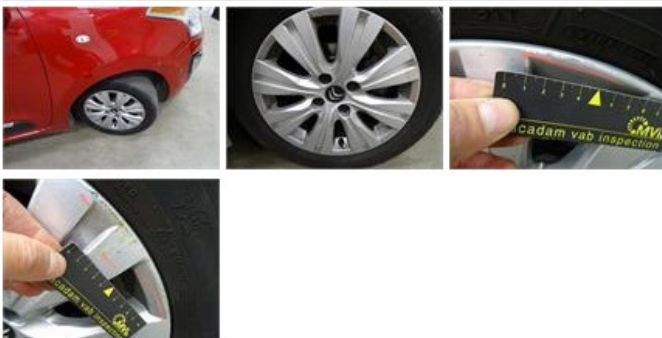

Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete) 115,56



Bumper grille, Deformed / Strained, E - Replace 30,72



Bumper R, Scratch(es), LI - Repair and paint (complete)

169,44



Door R R, Scratch(es), LI - Repair and paint (complete)

254,68



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

254,68



Bumper grille F L, Scratch(es), E - Replace

30,72

