



VOLKSWAGEN GOLF VII: 1KPZ733

Vinnumber:	VVWZZZAUZGP004022	Versionname:	1.6 TDI 81KW BMT TRENDLINE EUR6
First Registrationdate:	12/06/2015	Fiscalpower:	
Expertise Mileage:	78413	Power Kw:	81
Bodytype:	Hatchback	Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2622
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	No Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	195/55/15/91 H Steel			
Summer tyres:	Fr.L.	Hankook: 2 mm	Fr.R.	Hankook: 2 mm
	Re.L.	Hankook: 5 mm	Re.R.	Hankook: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT 3022,63

Bumper F, Dent(s) and scratch(es), Le - Replace and paint 735,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

0,00



Rear window, Scratch(es), E - Replace

0,00



Ignition key, Broken, E - Replace

150,00



Door R R, Scratch(es), LI - Repair and paint (complete)

318,35



Wing R R, Scratch(es), LI - Repair and paint (complete)

308,20



Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

220,18




Door R L, Dent(s), Acceptable

0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), Le - Replace and paint


651,00

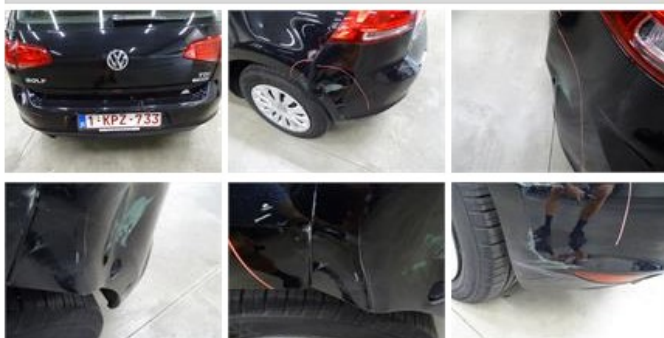



Wing F L, Dent(s), PDR - Paintless dent repair

63,00

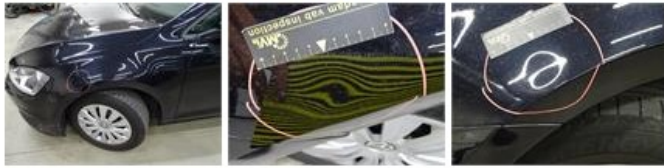


Bumper grille, Broken, E - Replace

32,40



Windscreen, Tear, E - Replace

0,00

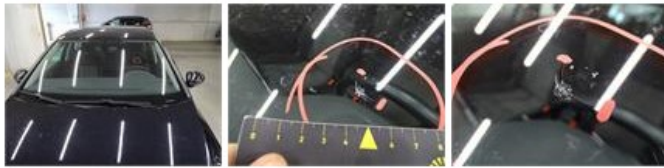

Roof, Dent(s) and scratch(es), LI - Repair and paint (complete)

481,50



Door F L, Scratch(es), Acceptable

0,00

No pictures to display

Door F R, Dent(s), PDR - Paintless dent repair

63,00

