



**RENAULT Clio: 1GXZ685**

Vinnumber:	<b>VF17R040H50938380</b>	Versionname:	<b>CLIO IV BRE Expression 75PK</b>
First Registrationdate:	<b>2/06/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>161842</b>	Power Kw:	<b>55</b>
Bodytype:		Body color:	<b>Black</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance:	<b>OK</b>	Parking lot:	<b>1726</b>
Battery functioning:	<b>Yes</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

GPS storage		Luggage cover	
GPS storage	<b>HD</b>	Type of Tow bar	<b>No Tow bar</b>
Windows electric F			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Manual climate control</b>		

**Limited Technical Inspection**


Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>185/6/1/88 T Steel</b>				
Summer tyres:	Fr.L.	<b>Michelin: 5 mm</b>	Fr.R.	<b>Michelin: 5 mm</b>
	Re.L.	<b>Bridgestone: 5 mm</b>	Re.R.	<b>Bridgestone: 5 mm</b>

**Assistance equipment**

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
Total cost ex VAT			<b>2912,78</b>
Interior, Stain, Cleaning			<b>100,00</b>

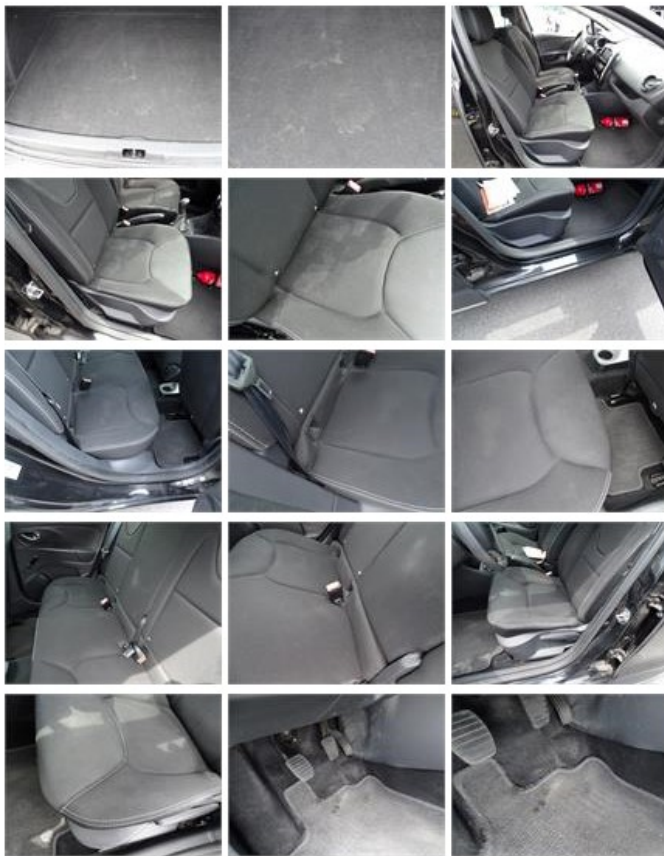

Wheel cover F R, Scratch(es), E - Replace

24,00



Bumper corner R L, Crack, Smart repair

158,64



Door F L, Scratch(es), Acceptable

0,00

No pictures to display

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

254,68



Luggage space cover, Scratch(es), Smart repair

110,64



Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete)

280,06







Wheel cover F L, Scratch(es), E - Replace

24,00



Wheel cover R L, Scratch(es), E - Replace

24,00



Bumper F, Scratch(es), Le - Replace and paint

607,20



Windscreen, Crack, E - Replace

413,76



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,56



Door F R, Scratch(es), Acceptable

0,00

No pictures to display

Wheel cover R R, Scratch(es), E - Replace

24,00



Bumper R, Scratch(es), Acceptable

0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,56



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

254,68

