



TOYOTA YARIS: 1JPN065

Vinnumber:	VNKKD3D310A145777	Versionname:	1.5 VVT-I HYBRID COMFORT AUTO
First Registrationdate:	2/02/2015	Fiscalpower:	
Expertise Mileage:	176690	Power Kw:	74
Bodytype:		Body color:	White
Gearbox:	Automatic	Paint type:	Opaque
Transmission:	Front	Rims summer:	Steel
Fueltype:	Hybrid Petrol	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3129
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Windows electric F	Luggage cover
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	No Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

175/65/15/84 H Steel				
Summer tyres:	Fr.L.	Dunlop: 4 mm	Fr.R.	Dunlop: 4 mm
	Re.L.	Dunlop: 4 mm	Re.R.	Dunlop: 4 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	3570,46
Bonnet, Dent(s), LI - Repair and paint (complete)	232,06

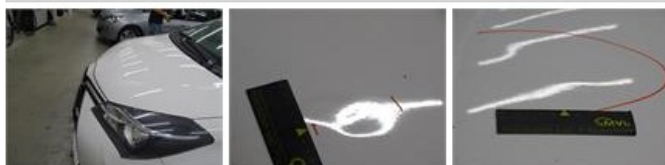



Gear shift lever knob, Worn, Acceptable 0,00

No pictures to display

Seat cover F L, Hole, E - Replace 312,00



Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete) 248,40



Interior, Dirty, Cleaning 50,00



Floor covering F L, Damaged, E - Replace 240,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 342,56



Wheel cover F L, Scratch(es), E - Replace 24,00



Wheel cover F R, Scratch(es), E - Replace 24,00



Bumper R, Broken, Le - Replace and paint 535,20



Wheel cover R R, Scratch(es), E - Replace 24,00



Door F L, Scratch(es), LI - Repair and paint (complete) 254,68



Boot carpet, Damaged, E - Replace 80,00



Door R L, Dent(s), LI - Repair and paint (complete) 254,68



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 254,68



Bumper F, Crack, Le - Replace and paint 607,20



Roof, Dent(s), PDR - Paintless dent repair 63,00



Wheel cover R L, Scratch(es), E - Replace 24,00



