


**PEUGEOT 308: 1HCL623**

Vinnumber:	<b>VF3LC9HCGES138941</b>	Versionname:	<b>308 SW e-HDi Allure STT 115PK</b>
First Registrationdate:	<b>18/06/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>93441</b>	Power Kw:	<b>85</b>
Bodytype:	<b>Break</b>	Body color:	<b>Brown</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3829</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

GPS storage		Central consol F	
GPS storage	<b>HD</b>	Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	<b>No Tow bar</b>
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting LED</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>205/55/16/91 V LightMetal</b>				
Summer tyres:	Fr.L.	<b>Michelin: 4 mm</b>	Fr.R.	<b>Michelin: 4 mm</b>
	Re.L.	<b>Michelin: 5 mm</b>	Re.R.	<b>Michelin: 5 mm</b>

**Assistance equipment**

Emergency spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		


Total cost ex VAT	<b>2967,63</b>
Wing F R, Bad repair, Acceptable	<b>0,00</b>



Window R L door, Scratch(es), 67 - Polish 0,00



Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

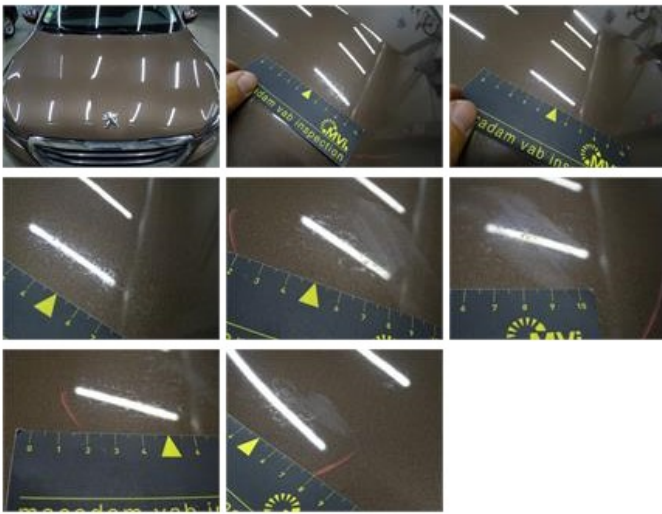

Wing R R, Bad repair, Acceptable 0,00



Roof, Chemical polution, LI - Repair and paint (complete) 481,50




Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



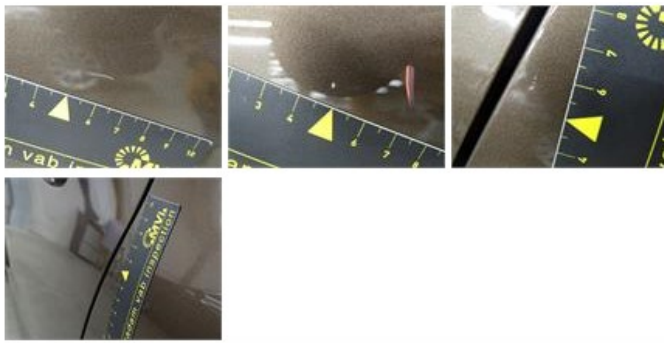

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Rear window, Scratch(es), E - Replace

370,00



Door F R, Bad repair, Acceptable

0,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Roof pillar R, Scratch(es), Acceptable 0,00

No pictures to display

Windscreen, Scratch(es), E - Replace 487,20





Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete)

310,50



Rearview mirror housing L, Scratch(es), Acceptable

0,00

No pictures to display

Door F L, Deformed / Strained, LI - Repair and paint (complete)

318,35



Alloy rim R L polished, Rust, Acceptable

0,00



Side window R L, Scratch(es), 67 - Polish

0,00



Door R R, Bad repair, Acceptable

0,00

