



RENAULT MASTER: 1PHJ262

Vinnumber:	VF1MAFGZG55582988	Versionname:	
First Registrationdate:	6/07/2016	Fiscalpower:	
Expertise Mileage:	102463	Power Kw:	120
Bodytype:	Transporter	Body color:	Light Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LCV15
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
Windows electric F		Rear parking sensors	
Radio multimedia		Type of Tow bar	Tow bar fixed
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

195/75/16/107 R Steel				
Summer tyres:	Fr.L.	Other: 9 mm	Fr.R.	Other: 9 mm
	Re.L.	Other: 5 mm	Re.R.	Other: 5 mm

Assistance equipment

Spare wheel	Yes
-------------	------------

Total cost ex VAT	2561,70
Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	238,76





Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

231,15



Wing trim R L, Broken, E - Replace

69,00



Headlight R, Broken, E - Replace

321,00



Trunk door R L, Dent(s) and scratch(es), It - Spot repair

115,56




Interior, Dirty, Cleaning

50,00



Door seal R R, Deformed / Strained, E - Replace

46,50

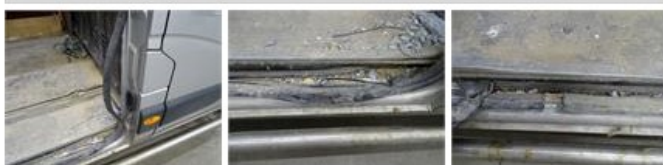


Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

231,15



Trunk door R R, Dent(s) and scratch(es), It - Spot repair

115,56

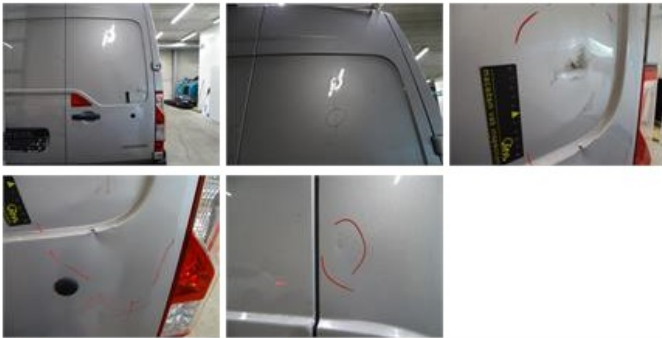

Bumper corner R R, Scratch(es), Smart repair

110,64



Bumper F, Deformed / Strained, E - Replace

398,40



Rearview mirror housing R, Broken, LI - Repair and paint (complete)

115,56



Steel rim R R, Deformed / Strained, E - Replace

72,60



Wheel cover F R, Broken, E - Replace

22,50



Wing R R 3P, Scratch(es), It - Spot repair

115,56



Wing trim R R, Scratch(es), E - Replace

69,00



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

238,76

