


**PEUGEOT 308: 1HGB572**

Vinnumber:	<b>VF3LBBHXHES159406</b>	Versionname:	<b>308 BER BlueHDi Allure STT 116PK</b>
First Registrationdate:	<b>11/07/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>101461</b>	Power Kw:	<b>85</b>
Bodytype:		Body color:	<b>Dark Blue</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2804</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	Front parking sensors
Steering wheel multifunctional	Rear parking sensors
Radio multimedia	Type of Tow bar
Type of headlighting	<b>Headlighting LED</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Autom climate control</b>
	<b>No Tow bar</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>205/55/16/91 V LightMetal</b>			
Summer tyres:	Fr.L.	<b>Michelin: 3 mm</b>	Fr.R.	<b>Michelin: 3 mm</b>
	Re.L.	<b>Michelin: 4 mm</b>	Re.R.	<b>Michelin: 4 mm</b>

**Assistance equipment**

Emergency spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

Total cost ex VAT	<b>2417,75</b>
-------------------	----------------

Wing R R, Scratch(es), Acceptable	<b>0,00</b>
-----------------------------------	-------------

*No pictures to display*

Bumper F, Scratch(es), Acceptable	<b>0,00</b>
-----------------------------------	-------------

*No pictures to display*

Alloy rim R R polished, Rust, Acceptable	<b>0,00</b>
--	-------------

*No pictures to display*

Door F.L., Scratch(es), Minor, Repair and paint (complete)	<b>210,00</b>
--	---------------

Door F L, Scratch(es), LI - Repair and paint (complete)

318,35



Alloy rim R L polished, Rust, Acceptable

0,00

No pictures to display

Bumper R, Hole, Le - Replace and paint

651,00



Door R L, Scratch(es), LI - Repair and paint (complete)

318,35



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Alloy rim F R polished, Scratch(es), E - Replace

235,20




Rearview mirror housing R, Scratch(es), Acceptable

0,00

No pictures to display

Roof, Chemical pollution, LI - Repair and paint (complete)

481,50

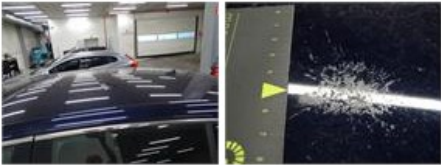

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Bonnet, Stone chip(s), Acceptable

0,00

No pictures to display