



AUDI A3 BERLINE: 1KAZ152

Vinnumber:	WAUZZZ8V9F1119117	Versionname:	1.6 TDI 81KW AMBIENTE
First Registrationdate:	23/03/2015	Fiscalpower:	
Expertise Mileage:	114603	Power Kw:	81
Bodytype:	Berline	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3212
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Front parking sensors	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/45/17/91 Y LightMetal				
Summer tyres:	Fr.L.	BF Goodrich: 7 mm	Fr.R.	BF Goodrich: 7 mm
	Re.L.	Pirelli: 6 mm	Re.R.	Pirelli: 6 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1776,34
Alloy rim R L, Scratch(es), LI - Repair and paint (complete)	95,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Sill outer R, Deformed / Strained, Le - Replace and paint

0,00




Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00





Protection plate M, Deformed / Strained, E - Replace 74,00

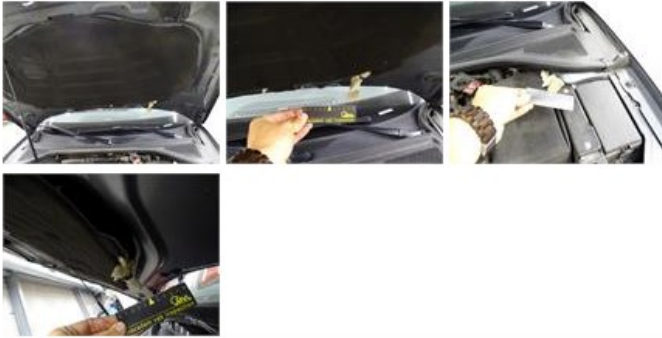

Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display


Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Chemical pollution, LI - Repair and paint (complete) 301,68

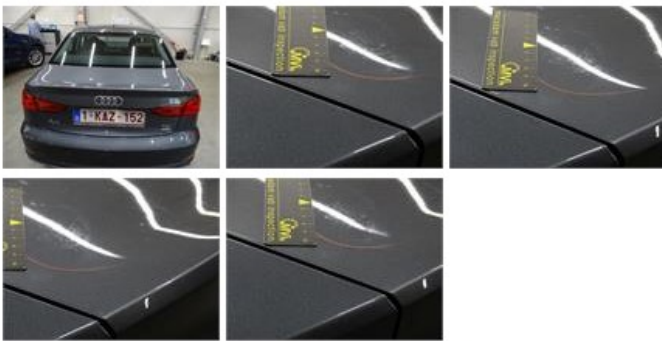

Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Door R L, Bad repair, Acceptable 0,00



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Spoiler R, Scratch(es), LI - Repair and paint (complete) 115,56



Roof, Chemical pollution, LI - Repair and paint (complete) 481,50



Wing F R, Scratch(es), Acceptable 0,00

No pictures to display