



BMW 4 GRAN COUPE: TJ4352			
Vinnumber:	WBA4D51010G321910	Versionname:	2.0 418D (105KW) GRAN COUPE
First Registrationdate:	16/07/2015	Fiscalpower:	
Expertise Mileage:	168359	Power Kw:	105
Bodytype:		Body color:	Dark Brown
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1312
Number of doors:	5		
Number of seats:	5		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options			
Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	225/50/18/98 W LightMetal			
Summer tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 5 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm

Assistance equipment			
Number of charging cables (normal)	0	Runflat	Yes
Number of charging cables (rapid charge)	0		

Total cost ex VAT		1737,20
Alloy rim R L, Scratch(es), LI - Repair and paint (complete)		95,00



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02




Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 382,02

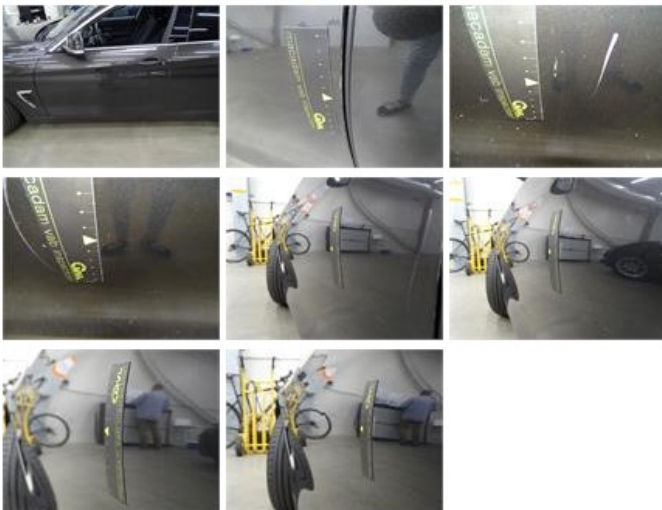

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 369,84



Bumper F, Scratch(es), LI - Repair and paint (complete) 254,16





Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Dent(s), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 254,16

