



**BMW 3: 1GNG357**

Vinnumber:	<b>WBA3D91060J413374</b>	Versionname:	<b>3 BER 316d 116PK</b>
First Registrationdate:	<b>17/03/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>174089</b>	Power Kw:	<b>85</b>
Bodytype:	<b>Berline</b>	Body color:	<b>Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Back</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2113</b>
Number of doors:	<b>4</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Sun Roof electric	
GPS storage		Central consol F	
GPS storage	<b>HD</b>	Rear parking sensors	
Windows electric F		Type of Tow bar	<b>Tow bar fixed</b>
Windows electric R			
Cruise Control			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining artificial leather</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>205/60/16/92 W LightMetal</b>				
Summer tyres:	Fr.L.	<b>Michelin: 4 mm</b>	Fr.R.	<b>Michelin: 4 mm</b>
	Re.L.	<b>Michelin: 3 mm</b>	Re.R.	<b>Michelin: 3 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
Number of charging cables (normal)	<b>0</b>		
Number of charging cables (rapid charge)	<b>0</b>		

<b>Total cost ex VAT</b>	<b>3392,48</b>
<b>Bonnet, Dent(s), LI - Repair and paint (complete)</b>	<b>290,08</b>



Door F R, Scratch(es), LI - Repair and paint (complete)

318,35



Bumper R, Deformed / Strained, Le - Replace and paint

651,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20






Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

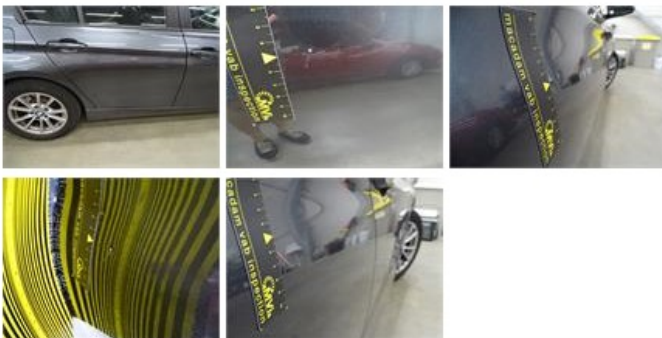

Inner door handle R L, Scratch(es), E - Replace

36,00



Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80





Headlight R, Scratch(es), E - Replace

396,00



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Roof, Chemical polution, Acceptable

0,00

*No pictures to display*

Tailgate, Scratch(es), Acceptable

0,00

*No pictures to display*

Door panel R L, Scratch(es), Acceptable

0,00

*No pictures to display*

Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00



Inner door handle F L, Broken, E - Replace

36,00



Steering wheel, Worn, Acceptable

0,00

*No pictures to display*

Wing F L, Scratch(es), Acceptable

0,00

*No pictures to display*

Door R L, Chemical polution, LI - Repair and paint (complete)

318,35





Seat cover F L, Worn, Acceptable

0,00

