



BMW 5 BERLINE: 1LAK027

Vinnumber:	WBA5E31040D673130	Versionname:	2.0 518D (110KW)
First Registrationdate:	3/08/2015	Fiscalpower:	
Expertise Mileage:	91528	Power Kw:	110
Bodytype:		Body color	Dark Blue
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	LCV
Number of doors	4		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
Windows electric F	Front parking sensors
Windows electric R	Rear parking sensors
Cruise Control	Type of Tow bar
Steering wheel multifunctional	No Tow bar
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control
Sport seats	

Limited Technical Inspection


Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/5/17/97 Y LightMetal				
Summer tyres:	Fr.L.	Bridgestone: 4 mm	Fr.R.	Bridgestone: 4 mm
	Re.L.	Bridgestone: 5 mm	Re.R.	Bridgestone: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1266,54
Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)			382,02

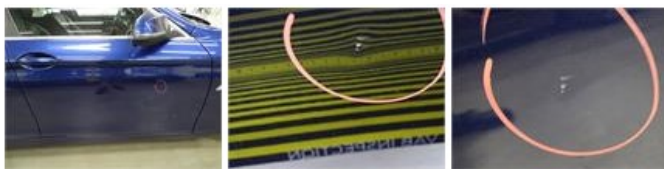

Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Ignition key, Missing, E - Replace 150,00

No pictures to display

Rearview mirror housing L, Scratch(es), Smart repair 110,64



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 254,16



Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 254,16



Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete) 115,56

