



PEUGEOT PARTNER: 1KPU427

Vinnumber:	VF37B9HN0FJ637944	Versionname:	1.6 HDI 120 L1H1 55KW CONFORT
First Registrationdate:	11/06/2015	Fiscalpower:	
Expertise Mileage:	61820	Power Kw:	55
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 5 VIT	Paint type:	Opaque
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4610
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	No GPS		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

195/65/15/91 T Steel				
Summer tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Other: 6 mm
	Re.L.	Other: 5 mm	Re.R.	Other: 3 mm

Assistance equipment

Spare wheel	Yes
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	2600,08
Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	231,15





Wheel cover R L, Scratch(es), E - Replace

22,50



Ignition key, Missing, E - Replace

150,00

No pictures to display

Wing R R, Scratch(es), LI - Repair and paint (complete)

231,15



Bodywork, Glue residues, Acceptable

0,00



Wheel cover R R, Scratch(es), E - Replace

22,50




Bumper R, Scratch(es), Smart repair

110,64



Roof, Dent(s) and scratch(es), LI - Repair and paint (complete)

361,13

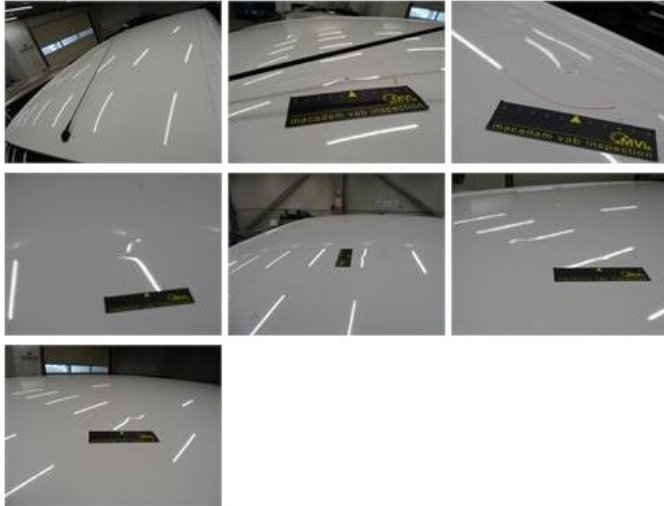

Trunk door panel L, Broken, E - Replace

64,00



Wing trim R L, Scratch(es), E - Replace

69,00



Tyre F R, Not original part, E - Replace

105,00



Wing F R, Scratch(es), Acceptable

0,00

No pictures to display

Wheel cover F R, Scratch(es), E - Replace

22,50





Trunk door R L, Dent(s), It - Spot repair

115,56



Trunk door R R, Dent(s) and scratch(es), It - Spot repair

115,56



Wheel cover F L, Scratch(es), E - Replace

22,50



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

238,76



Ignition key, Broken, E - Replace


150,00



Bumper F, Scratch(es), LI - Repair and paint (complete) 158,85



Interior, Dirty, Cleaning 50,00

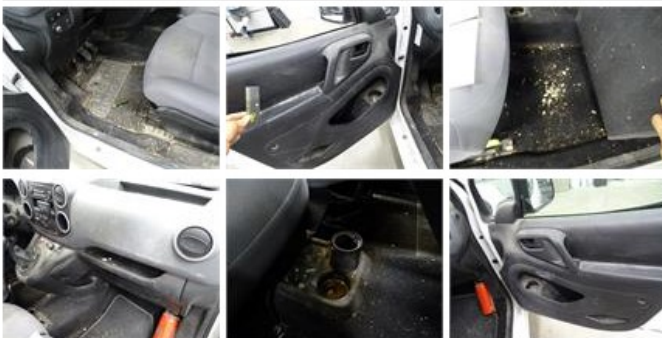

Door moulding Lower R R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F M, Scratch(es), Smart repair 110,64



Rearview mirror L complete, Broken, E - Replace 138,00



Rearview mirror housing R, Scratch(es), Smart repair 110,64



Door F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door moulding Lower F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	