



BMW 5 BERLINE: 1KJX575

Vinnumber:	WBA5E51090G101481	Versionname:	2.0 520D (120KW)
First Registrationdate:	18/05/2015	Fiscalpower:	
Expertise Mileage:	158389	Power Kw:	120
Bodytype:	Berline	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2730
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Sun Roof electric	
GPS storage		Central consol F	
GPS storage	HD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

245/45/18/100 V LightMetal				
Winter tyres:	Fr.L.	Uniroyal: 7 mm	Fr.R.	Uniroyal: 7 mm
	Re.L.	Uniroyal: 6 mm	Re.R.	Uniroyal: 6 mm

Assistance equipment

Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	1465,49
Interior, Worn, Acceptable	0,00



Door panel R L, Scratch(es), Smart repair

110,64



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper R, Scratch(es), Acceptable

0,00

No pictures to display

Door R R, Scratch(es), Acceptable

0,00

No pictures to display

Tyre R R, Tear, Acceptable

0,00



Sill outer L, Scratch(es), LI - Repair and paint (complete)

372,60



Seat cover R L, Stain, Cleaning

0,00



Door F L, Scratch(es), Acceptable

0,00

No pictures to display

Roof, Dent(s) and scratch(es), Acceptable

0,00

No pictures to display

Tailgate, Scratch(es), Acceptable

0,00

No pictures to display

Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

254,16



Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Floor covering R, Stain, Cleaning 0,00



Wing R L, Dent(s) and scratch(es), Acceptable 0,00


No pictures to display

Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete) 348,09



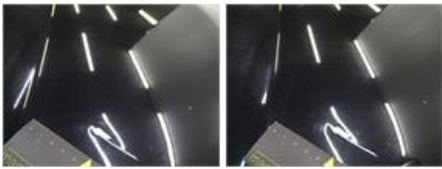

Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)

95,00

