



BMW X4: 1LET143			
Vinnumber:	WBAXX110X00R35988	Versionname:	2.0 XDRIVE20D (120KW) 4WD
First Registrationdate:	8/09/2015	Fiscalpower:	
Expertise Mileage:	120144	Power Kw:	120
Bodytype:	SUV	Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	4 Weel	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3302
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		


Options			
Radio CD		Sun Roof electric	
GPS storage		Central consol F	
GPS storage	HD	Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	245/50/18/100 W LightMetal			
Summer tyres:	Fr.L.	Pirelli: 3 mm	Fr.R.	Pirelli: 3 mm
	Re.L.	Pirelli: 4 mm	Re.R.	Pirelli: 4 mm

Assistance equipment			
Number of charging cables (normal)	0	Runflat	Yes
Number of charging cables (rapid charge)	0		

Total cost ex VAT	898,80
Bumper R, Deformed / Strained, Le - Replace and paint	766,80

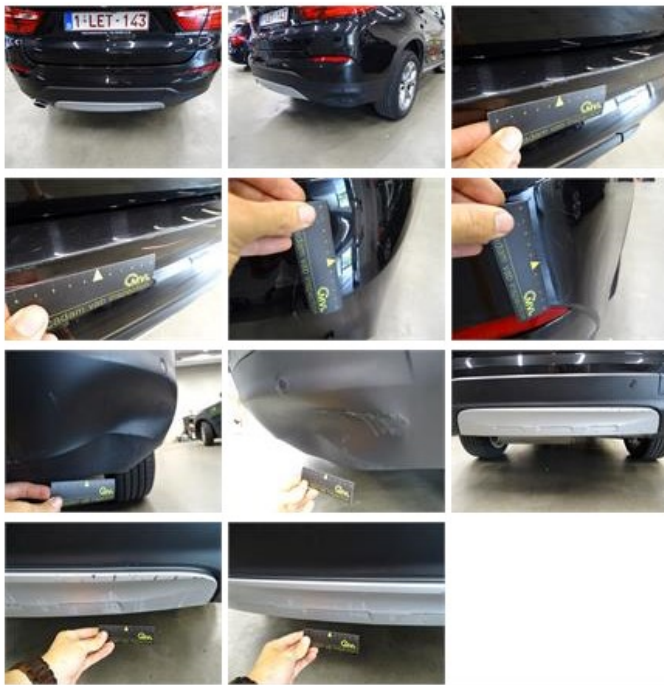

Windscreen, Repaired, Acceptable 0,00

No pictures to display

Door moulding Lower R L, Scratch(es), E - Replace 132,00



Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L polished, Rust, Acceptable 0,00



Door F R, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Door R R, Dent(s), Acceptable 0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Door R L, Bad repair, Acceptable 0,00



Tailgate, Dent(s), Acceptable 0,00

No pictures to display