


SKODA OCTAVIA: 1LNBS22

Vinnumber:	TMBAF7NE2G0075888	Versionname:	1.6 CRTDI 66KW GREENTEC AMBITION
First Registrationdate:	26/10/2015	Fiscalpower:	
Expertise Mileage:	180118	Power Kw:	66
Bodytype:		Body color	Light Blue
Gearbox:	MAN 5 VIT	Paint type	Metalic
Transmission:		Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	2301
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	No Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/5/16/91 V Steel			
Summer tyres:	Fr.L.	Uniroyal: 3 mm	Fr.R.	Uniroyal: 3 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	999,92
Wheel cover R R, Scratch(es), Acceptable	0,00
No pictures to display	
Tailgate, Scratch(es), Acceptable	0,00
No pictures to display	
Wheel cover F L, Scratch(es), Acceptable	0,00
No pictures to display	
Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete)	290,08



Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Roof, Dent(s), PDR - Paintless dent repair 63,00




Wheel cover F R, Scratch(es), Acceptable 0,00

No pictures to display

Sill outer R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s), PDR - Paintless dent repair 102,60

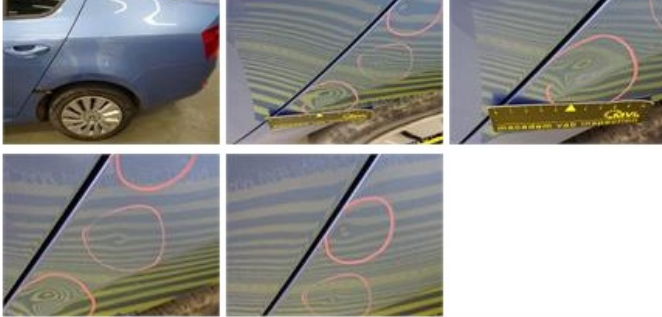

Bumper R, Deformed / Strained, Smart repair 110,64



Reflector, Broken, E - Replace

10,00

