



VOLVO XC60: 1JSF653

Vinnumber:	YV1DZ31A1F2729571	Versionname:	2.0 D3 2WD KINETIC
First Registrationdate:	12/02/2015	Fiscalpower:	
Expertise Mileage:	177497	Power Kw:	100
Bodytype:	SUV	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1213
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F	
Windows electric F	Luggage cover	
Windows electric R	Front parking sensors	
Cruise Control	Rear parking sensors	
Steering wheel multifunctional	Type of Tow bar	Tow bar fixed
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

235/65/17/104 V LightMetal			
Summer tyres:	Fr.L.	Fr.R.	Continental: 4 mm
	Re.L.	Re.R.	Semperit: 8 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1489,28
Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)	382,02





Alloy rim F L, Scratch(es), Acceptable

0,00

No pictures to display

Wing F R, Dent(s), PDR - Paintless dent repair

82,80




Wing R R, Dent(s), PDR - Paintless dent repair

63,00



Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00

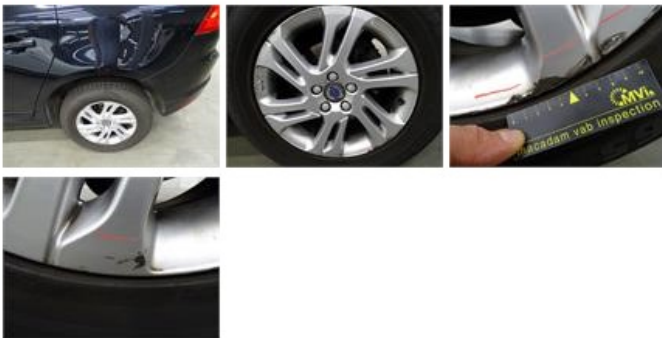

Alloy rim R R, Scratch(es), Acceptable

0,00

No pictures to display

Door R R, Dent(s) and scratch(es), Acceptable

0,00

No pictures to display

Door R L, Scratch(es), 67 - Polish

0,00

No pictures to display

Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

264,21



Bumper R, Scratch(es), LI - Repair and paint (complete)

254,16

