



CITROEN C4 Picasso: 1GWE750

Vinnumber:	VF73A9HC8EJ635073	Versionname:	GR.C4 PICASSO Business GPS 115PK
First Registrationdate:	16/05/2014	Fiscalpower:	
Expertise Mileage:	82385	Power Kw:	85
Bodytype:	MPV	Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2210
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Radio multimedia	No Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/60/16/92 H LightMetal				
Summer tyres:	Fr.L.	Bridgestone: 5 mm	Fr.R.	Bridgestone: 5 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Emergency spare wheel	Yes
-----------------------	------------

Total cost ex VAT	2578,88
-------------------	----------------

Door R L, Scratch(es), LI - Repair and paint (complete)	318,35
---	---------------





Roof, Chemical polution, LI - Repair and paint (complete)

481,50




Alloy rim R R, Scratch(es), Acceptable

0,00

No pictures to display


Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

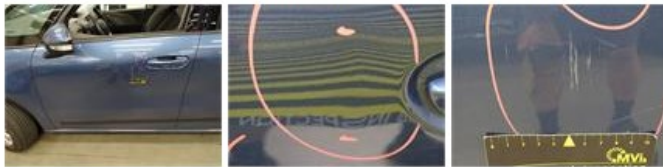

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

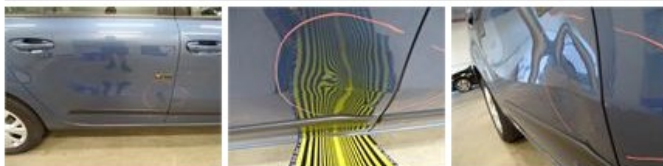

Wing F L, Scratch(es), Acceptable

0,00

No pictures to display

Bumper R, Scratch(es), Acceptable

0,00

No pictures to display

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Alloy rim F R, Scratch(es), 67 - Polish

0,00

No pictures to display

Tailgate, Scratch(es), LI - Repair and paint (complete)

301,68



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete)

310,50

