


BMW 3 TOURING: 1JVL621

Vinnumber:	WBA3K11010F838284	Versionname:	2.0 318D (100KW) TOURING
First Registrationdate:	6/03/2015	Fiscalpower:	
Expertise Mileage:	165607	Power Kw:	100
Bodytype:	Break	Body color:	Dark Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3110
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/96 V LightMetal			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment


Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	321,20
-------------------	--------

Roof, Scratch(es), Acceptable	0,00
-------------------------------	------


No pictures to display

Door panel R R, Tear, Smart repair	110,64
------------------------------------	--------

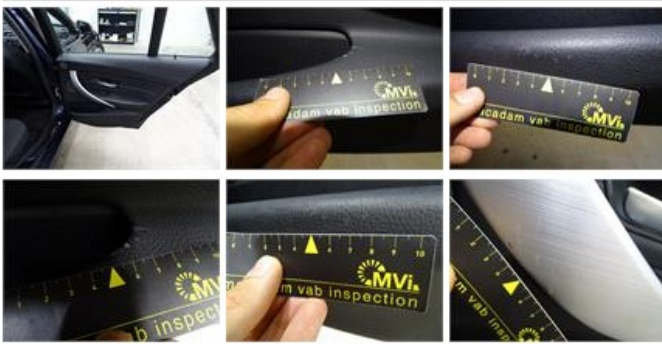

Rear spoiler, Chemical polition, LI - Repair and paint (complete)

115,56

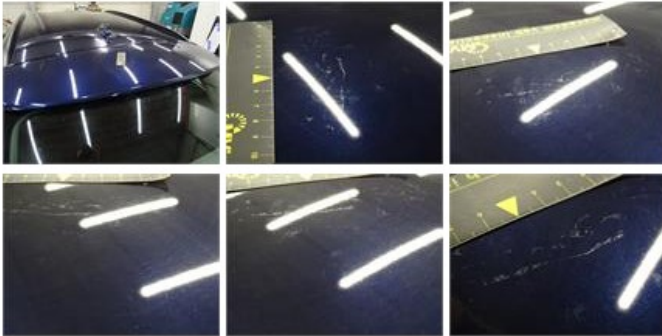

Alloy rim F L, Scratch(es), Acceptable

0,00

No pictures to display

Rocker panel inner R R, Dent(s), Acceptable

0,00

No pictures to display

Door R L, Repaired, Acceptable

0,00



Door R R, Repaired, Acceptable

0,00



Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00



Door F R, Repaired, Acceptable

0,00





Door panel R L, Scratch(es), Acceptable	0,00
---	------

No pictures to display

Door F L, Repaired, Acceptable	0,00
--------------------------------	------



Wing R L, Repaired, Acceptable	0,00
--------------------------------	------



Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display