



VOLKSWAGEN Passat: 1HBX078

Vinnumber:	WVWZZZ3CZFE002019	Versionname:	PASSAT VAR Highline 136PK
First Registrationdate:	13/06/2014	Fiscalpower:	
Expertise Mileage:	111695	Power Kw:	100
Bodytype:	Break	Body color:	Dark Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1715
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Sun Roof electric
Windows electric F	Panoramic roof
Windows electric R	Central consol F
Steering wheel multifunctional	Luggage cover
Seats F heated	Front parking sensors
Type of headlighting	Rear parking sensors
Type of GPS	Type of Tow bar
Type of Lining	
Type of climate control	

Headlighting Halogen
GPS big screen color
Lining leather
Autom climate control

Tow bar fixed

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	235/45/17/94 Y LightMetal			
Summer tyres:	Fr.L.	Pirelli: 6 mm	Fr.R.	Pirelli: 6 mm
	Re.L.	Fulda: 5 mm	Re.R.	Fulda: 5 mm

Assistance equipment

Total cost ex VAT	1340,15
Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00





Roof, Bad repair, Acceptable 0,00



Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Hail damage, PDR - Hail 250,00



Rear window, Scratch(es), E - Replace 370,00



Door R L, Scratch(es), 67 - Polish 0,00

No pictures to display

Roof, Dent(s), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 05,00


Alloy rim R L, Scratch(es), LI - repair and paint (complete)

95,00




Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

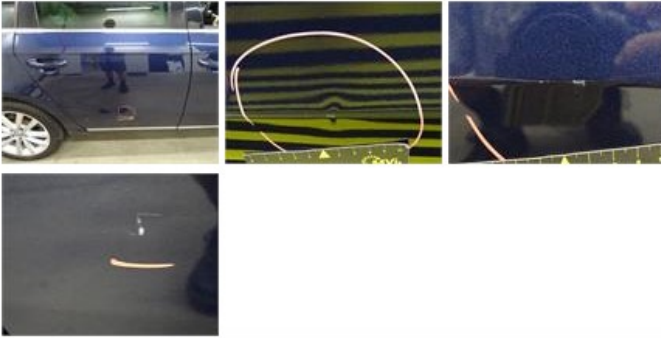

Bonnet, Bad repair, Acceptable

0,00

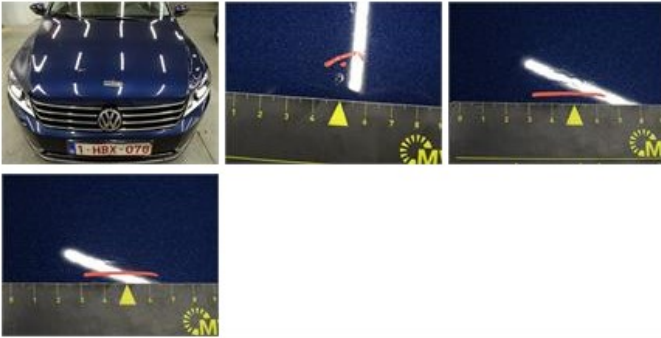

Wing R L, Scratch(es), Acceptable

0,00

No pictures to display