



AUDI A3 SPORTBACK: 1KVS092

Vinnumber:	WAUZZZ8V9GA016135	Versionname:	1.6 TDI ULTRA ATTRACTION SPORTBACK
First Registrationdate:	15/07/2015	Fiscalpower:	
Expertise Mileage:	133320	Power Kw:	81
Bodytype:	Hatchback	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2522
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F	
Windows electric F	Luggage cover	
Windows electric R	Rear parking sensors	
Cruise Control	Type of Tow bar	No Tow bar
Steering wheel multifunctional		
Seats F heated		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining leather	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/91 V LightMetal				
Summer tyres:	Fr.L.	BF Goodrich: 6 mm	Fr.R.	BF Goodrich: 6 mm
	Re.L.	BF Goodrich: 7 mm	Re.R.	BF Goodrich: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT 1702,15

Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Bonnet, Scratch(es), 67 - Polish 0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00






Wing R L, Scratch(es), 67 - Polish	0,00
------------------------------------	------

No pictures to display

Bonnet, Dent(s), Acceptable	0,00
-----------------------------	------

No pictures to display

Roof, Scratch(es), LI - Repair and paint (complete)	481,50
---	--------

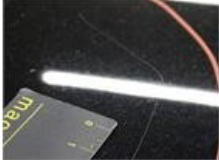

Sill outer R, Scratch(es), LI - Repair and paint (complete)	310,50
---	--------

